



# **ENVIRONMENTAL SITE ASSESSMENT**

**(Phase I)**

**Parcel No: S95-046**  
**14,400 sq. ft. of Vacant Land**  
**7300 Crownwest Drive**  
**Houston, Texas**

**Prepared for:**  
**City of Houston**  
**C/O Gabriel Mussio**  
**900 Bagby, 2nd Floor**  
**Houston, Texas 77002**

**Project # 0604161.6**

**Prepared by:**

**Environmental Resource Consultants (ERC)**  
10801 Hammerly Boulevard, Suite 222  
Houston, Texas 77043  
(713) 290-9444

**Greg Carter, CHMM, REP**  
**Project Manager**

A handwritten signature in black ink, appearing to read "Greg Carter", written over a horizontal line.

**Signature**

**Kommy M. Azarpour, PE**  
**Principal**

A handwritten signature in black ink, appearing to read "Kommy M. Azarpour", written over a horizontal line.

**Signature**

**April 25, 2006**

# TABLE OF CONTENTS

---

<b>1.0</b>	<b>Executive Summary</b> .....	1
1.1	Scope.....	1
1.2	Findings .....	1
1.3	Conclusions .....	2
1.4	Recommendations .....	3
<b>2.0</b>	<b>Objectives and Limitations of Assessment</b> .....	4
<b>3.0</b>	<b>Site Reconnaissance</b> .....	6
3.1	Site Description.....	6
3.2	Onsite Interviews .....	6
3.3	Site Overview.....	6
3.4	Adjoining Properties.....	9
<b>4.0</b>	<b>Historical Site Background</b> .....	10
4.1	Aerial Photographs .....	10
4.2	Chain of Title and Historical Ownership .....	12
<b>5.0</b>	<b>Environmental Settings</b> .....	13
5.1	Topography/Surface Water Conditions .....	13
5.2	Flood Plain Status.....	13
5.3	Wetlands.....	13
5.4	Site Geology .....	13
5.5	Faults .....	14
5.6	Site Soil Conditions.....	14
5.7	Regional Groundwater Conditions .....	15
<b>6.0</b>	<b>Regulatory Review</b> .....	16
6.1	Federal Database Review .....	17
6.2	State Database Review .....	18
6.3	Additional Environmental Record Sources .....	23
<b>7.0</b>	<b>Findings</b> .....	22
<b>8.0</b>	<b>Conclusions and Recommendations</b> .....	24

## APPENDICES

Appendix A	-	Site Maps
Appendix B	-	Aerial Photographs
Appendix C	-	Topographic Maps
Appendix D	-	Maps
Appendix E	-	Photograph Log
Appendix F	-	Property Records
Appendix G	-	Government Database Report
Appendix H	-	Government Data and File Review

# SECTION I

## EXECUTIVE SUMMARY

# SECTION I – EXECUTIVE SUMMARY

---

## 1.0 Executive Summary

Environmental Resource Consultants (ERC) was retained by **Mr. Gabriel Mussio of the City of Houston** to conduct a Phase I Environmental Site Assessment according to generally accepted principles and practices at the time of this report and in compliance with the American Society for Testing and Materials Committee E-50 Designated E 1527-00, “Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process”.

The subject property is located at 7300 Crownwest Drive in Houston, Harris County, Texas; consists of approximately 14,400 sq. ft. of vacant land. The property is covered with grass and native vegetation. The subject site is bounded by a church to the north, apartments to the south and west, and by an open field to the east.

The vicinity of the property can be described as residential and industrial development in conjunction with churches and schools.

The Phase I Environmental Assessment of the subject property was conducted by Mr. Greg Carter, CHMM, REP, Project Manager, and reviewed by Mr. Kommy M. Azarpour, PE, Principal, at the request of Mr. Gabriel Mussio. Mr. Greg Carter, CHMM, REP conducted data acquisition from April 21 to April 27, 2006. No one accompanied Mr. Carter during the site visit on April 7, 2006.

### 1.1 Scope

The purpose of the Phase I Environmental Site Assessment was to determine the status of the subject property with respect to certain physical and environmental factors. Information concerning the subject property was acquired through a site visit, regulatory agency records, historical research and in-person interviews when available.

### 1.2 Findings

The following specific categories of environmental risk were evaluated during the site visit and research phases of the project:

**Site Inspection** The subject property is located at 7300 Crownwest Drive in Houston, Texas. The subject site consists of approximately 14,400 sq. ft. of land covered with native vegetation. The site is currently vacant and unfenced.

The vicinity of the property can be generally described as residential with industrial developments nearby.

## SECTION I – EXECUTIVE SUMMARY

---

**Hazardous Material Use, Handling & Storage** During the site investigation, no containers, drums, and hazardous substance or petroleum products were observed. Small amounts of debris are spread throughout the site. It is recommended that these areas be cleaned up and disposed in accordance to federal, state and local guidelines.

**Asbestos-Containing Materials (ACM)** Use of asbestos-containing materials (ACM) was discontinued in the late 1970's, after the Environmental Protection Agency (EPA) regulated it. No ACM survey was conducted since the site is comprised of vacant land,

**Hazardous Waste Sites** No hazardous waste sites were observed on the subject property at the time of the site inspection. Small amounts of debris are spread throughout the site. It is recommended that these areas be cleaned up and the trash disposed in accordance to federal, state and local guidelines

**Polychlorinated Biphenyls (PCB's)** No pole-mounted transformers were observed on surrounding the site.

**Radon** Subject site is located in an area to have radon concentrations well below the Federal (EPA) guideline or 4.0 picocuries per Liter. Testing for the presence of radon gas was not included in the scope of this Phase I Environmental Site Assessment.

**Soil and Groundwater Quality** The Phase I Environmental Site Assessment did not address the quality of either the soil or groundwater conditions at the subject property (the scope-of-work consisted only of a visual examination of the premises and the database review to determine the likelihood of a sub-surface contamination).

**Agency Review** A review of available federal, state, and local agency records revealed three (3) Leaking Underground Storage Tank sites within a 0.5 mile radius of the subject property, and six (6) Texas Underground Storage Tank facilities within a 0.25-mile radius of the subject. According the TelALL database records, and visual site inspection, none of the sites listed pose a potential environmental concern to the subject property.

## SECTION I – EXECUTIVE SUMMARY

---

### 1.3 Conclusions

Environmental Resource Consultants (ERC) has performed a Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM Practice E 1527 of the subject property consist of approximately 14,400 sq. ft. of vacant land in Houston, Texas.

Any exceptions to, or deletions from, this practice are described in Section 2.0 of this report. This assessment has revealed the following evidence of recognized environmental conditions in connection with the subject property:


- The subject property is located at 7300 Crownwest Drive in Houston, Texas. The subject site consists of approximately 14,400 sq. ft. of land covered with native vegetation. The site is currently vacant and unfenced.
- During the site investigation, no containers, drums, and hazardous substance or petroleum products were observed. Also no hazardous wastes site appeared at the site. Small amounts of debris are located on the site. It is recommended that these areas be cleaned up and the trash disposed in accordance to federal, state and local guidelines.
- A review of available federal, state, and local agency records revealed three (3) Leaking Underground Storage Tank sites within a 0.5 mile radius of the subject property, and six (6) Texas Underground Storage Tank facilities within a 0.25-mile radius of the subject. According the TelALL database records, and visual site inspection, none of the sites listed pose a potential environmental concern to the subject property.
- Three (3) TXLUST facilities were identified within the search radius. According to the TelALL database report, the former Diamond Shamrock 2502, located at 7621 Cook road, is approximately .17 miles southeast and down gradient in respect to the subject property. The release was reported on March 9, 1998. According to TCEQ, groundwater was impacted. Also identified was the Stop and Go 3554 located at 7621 Cook Road, which is approximately 0.17 miles southeast and down gradient in respect to the subject property. The release was reported on August 28, 1990. According to TCEQ, groundwater was impacted. TCEQ issued a final concurrence and closed the case. Lastly, Reliant Energy Entex West Dist. was identified. It is located at 12330 Bellaire, it is approximately 0.38 miles northeast and cross gradient in respect to the subject property. The release was reported on December 13, 1993. According to TCEQ, no groundwater was impacted. TCEQ issued a final concurrence and closed the case. Due to the distance from the subject property and the status of the facility, no potential for environmental concern to the subject property is anticipated.

## **SECTION I – EXECUTIVE SUMMARY**

---

### **1.4 Recommendations**

Based on the site visit and research conducted at the local and state level regarding the subject property including historical sources, it appears there is minimal potential for environmental concerns to the subject property and no further investigation is warranted.

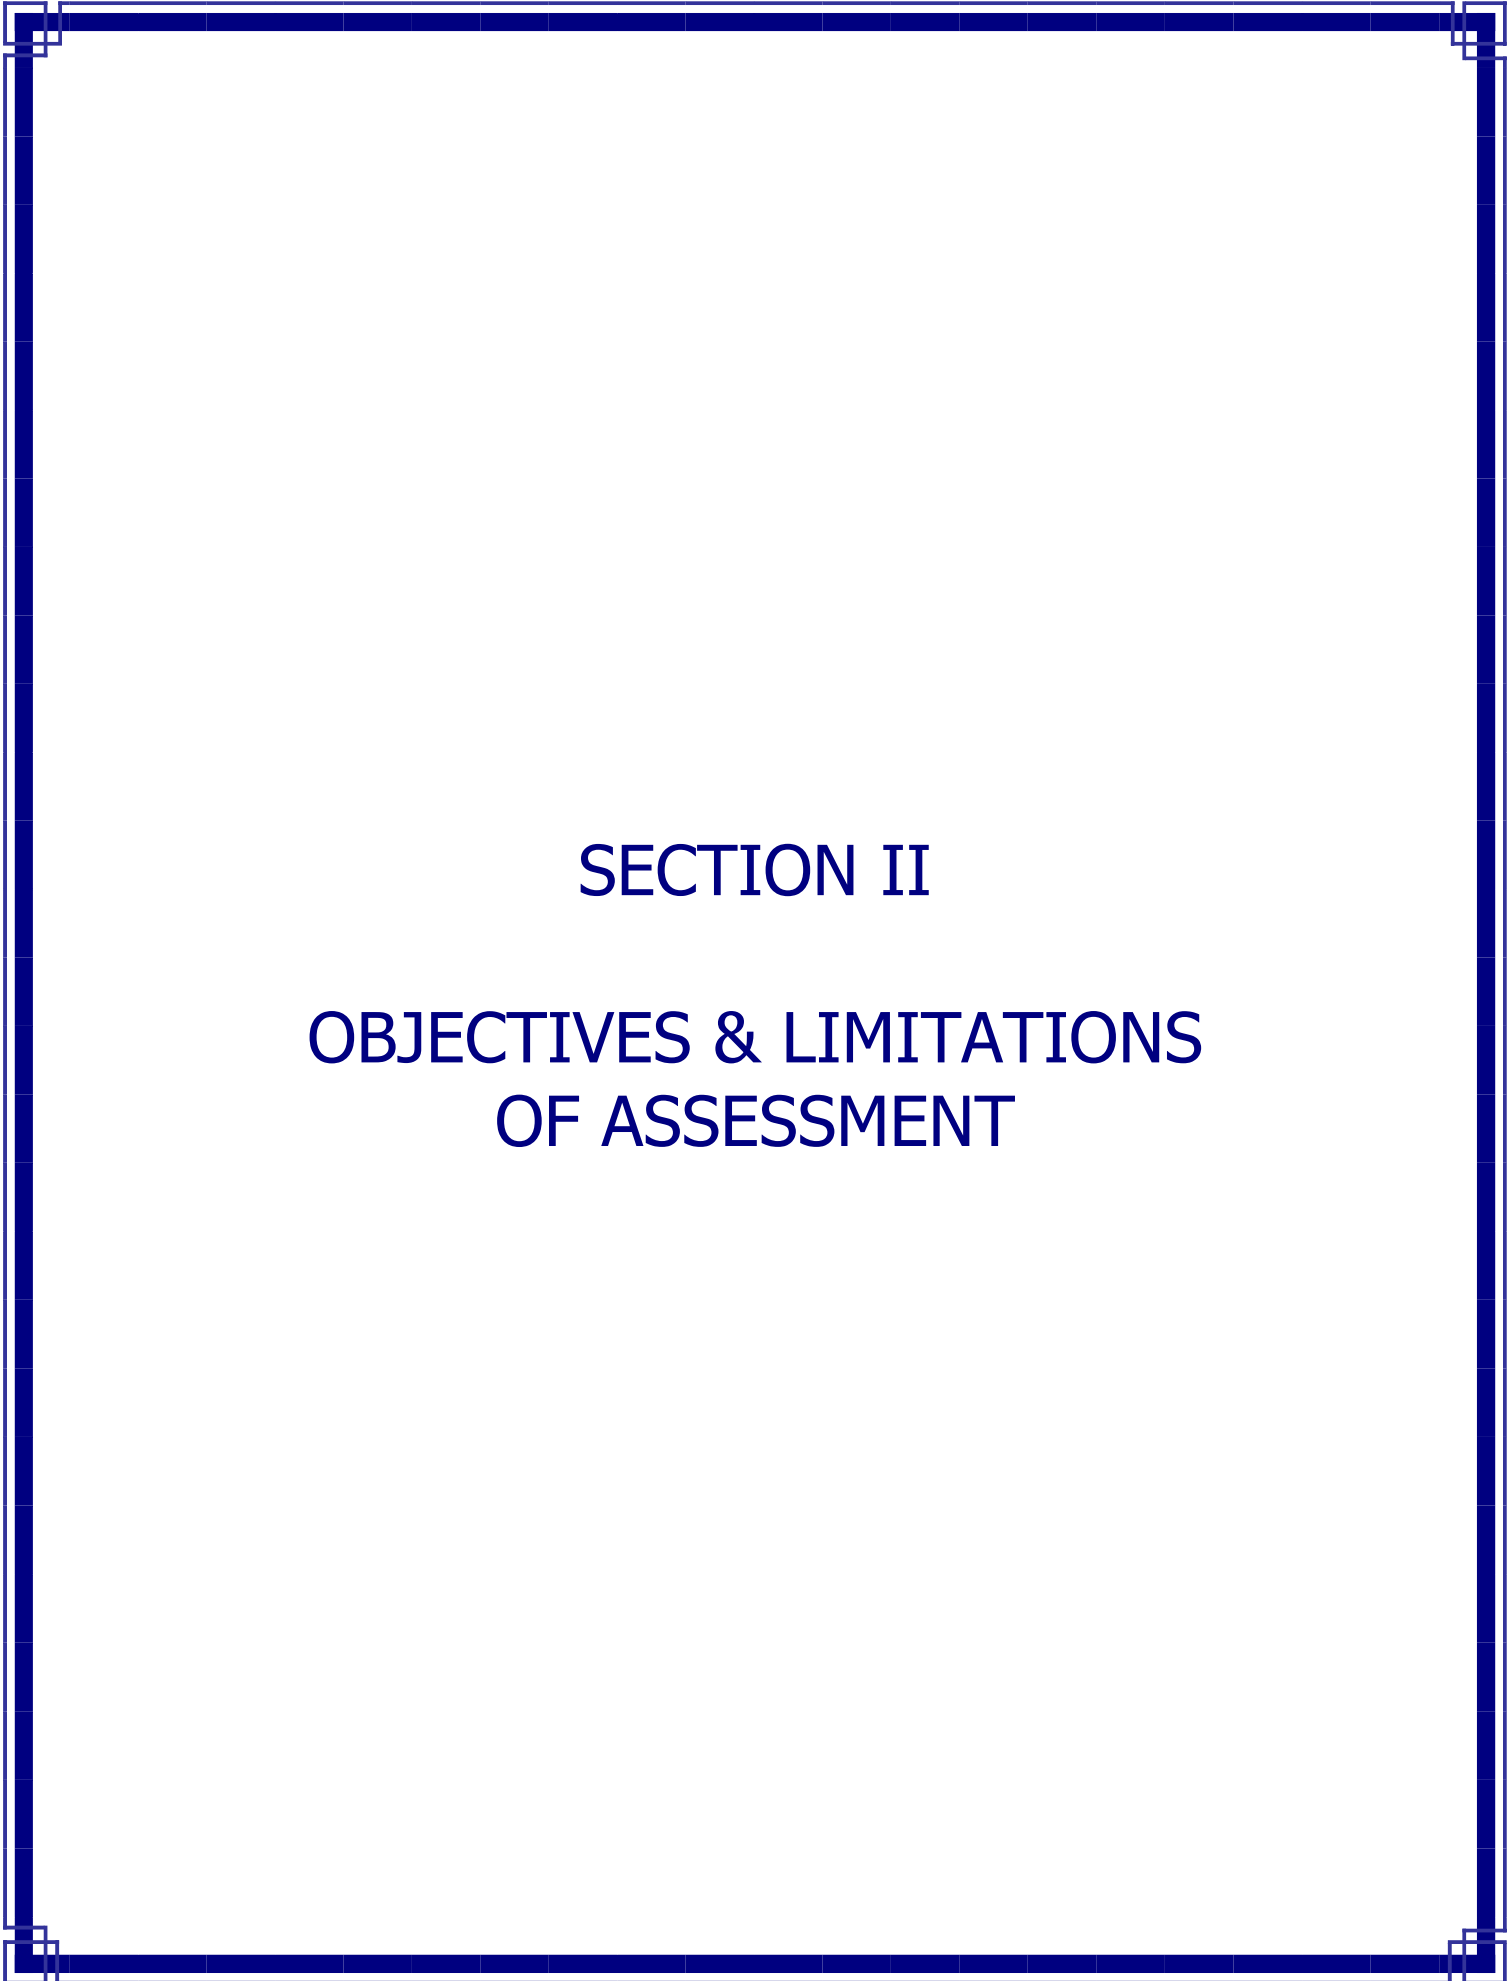

## SECTION II

# OBJECTIVES & LIMITATIONS OF ASSESSMENT



## **SECTION II – OBJECTIVES AND LIMITATIONS**

---

### **2.0 Objectives and Limitations of Assessment**

#### **Objectives of Assessment**

The Phase I Environmental Site Assessment of the property is based on readily available data, personal interviews and the evidence encountered during a walking inspection of the site. The following work segments comprised the scope-of-work of the project:

1. A review of the available historical records relating to the subject property and its use including aerial photographs. A fifty-year Chain of Title was not requested as a part of this Phase I ESA.
2. A review of the available construction, management and operational records relating to the subject property.
3. Interviews with owners, managers, employees, neighbors and others with knowledge of the subject property and its use.
4. A review of local, state and federal databases regarding the environmental status of the subject property, adjoining properties, and the nearby area.
5. A site visit and visual inspection of the subject property.
6. To the extent possible, an investigation into the use and character of properties adjacent to, or near to, the subject property.
7. A review of the local environmental setting including topography, floodplain status, geology, faults, local soils, and regional groundwater conditions.

#### **Limitations of Assessment**

This report is an instrument of service of ERC and includes limited research, a review of specified and reasonably ascertainable listings and a site reconnaissance to identify "recognized environmental conditions" in general accordance with the American Society for Testing and Materials (ASTM) Standard E1527-00; however, this ESA may reflect additional or reduced services or service enhancements requested or authorized by the Client.

## **SECTION II – OBJECTIVES AND LIMITATIONS**

---

This study and report has been prepared on behalf of and for the exclusive use of the City of Houston. It is intended solely for its use and reliance in the environmental assessment of this site. The City of Houston are the only parties to which ERC has explained the risks involved and which has been incorporated in the shaping of the scope of services needed to satisfactorily manage those risks, if any, from City of Houston's point of view. Accordingly, reliance on this report by any other party may involve assumptions whose extent and nature lead to a distorted meaning and impact of the findings and opinions related herein. ERC's findings and opinions related in this report may not be relied upon by any party except City of Houston with the consent of City of Houston and ERC. ERC may be available to contract with other parties to develop findings and opinions related specifically to such other parties' unique risk management concerns related to the site.

This ESA did not include any inquiry with respect to radon, methane, lead-based paint, lead in drinking water, formaldehyde, wetlands, subsurface investigation activities or other services or potential conditions or features not specifically identified and discussed herein. In those instances where additional services or service enhancements are included in the report, as requested or authorized by the client, specific limitations attendant to those services are presented in the text of the report.

The Phase I Environmental Site Assessment of the subject property was performed in accordance with generally accepted standards of professional care. Because of its limited scope and budget, however, it is only useful as a general diagnostic tool to determine the likelihood of the presence of environmental problems affecting the subject property. The Phase I Environmental Site Assessment is not, and should not be construed as, a warranty or guarantee regarding the presence or absence of environmental contaminants that might affect the subject property. The Phase I Environmental Site Assessment consists only of the professional opinion of the individual conducting the assessment, and does not involve sampling, testing or analysis of either the soil or groundwater at the subject property.



# SECTION III

## SITE RECONNAISSANCE

## SECTION III – SITE RECONNAISSANCE

---

### 3.0 Site Reconnaissance

#### 3.1 Site Description

The subject property is located at 7300 Crownwest Drive in Houston, Texas. The subject site consists of approximately 14,400 sq. ft. of land covered with native vegetation. The site is currently vacant. The site is unfenced with storm drains running south along Crownwest Drive.

The vicinity of the property can be generally described as residential with light retail developments in the surrounding area. The property is covered with grass and native vegetation. The subject site is bounded by a church to the north, apartments to the south and west and by an open field to the east.

#### 3.2 Onsite Interviews

No individuals were available for onsite interviews during the site visit to the subject property.

#### 3.3 Site Overview

##### **Legal description**

No legal description was given.

##### **Previous use**

The site is currently vacant land and currently owned by the City of Houston. Most recently the site was utilized for a small water plant. Prior to that the site was used for agricultural purposes.

##### **Surrounding Land-Use**

The properties adjacent to the tract include vacant land and streets, along with residential, and industrial structures. The use of the adjacent land is as follows:

**North:** Chapel of Praise Church, Sandstone Street, followed by residential homes.

**South:** An apartment complex.

**East:** An empty lot, Cook road, followed by residential homes.

**West:** Crownwest Drive, followed by the Crown Colony Town homes community.

## SECTION III – SITE RECONNAISSANCE

---

### **Current use**

The subject property is currently a parcel of vacant land. It is unused and covered with native vegetation.

### **Source of Drinking Water**

The subject property and surrounding properties receive their drinking water from the City of Houston.

### **Sewage Disposal/Septic System**

The subject property is connected to a municipal sewer system that is serviced by the City of Houston.

### **Hazardous Substances and Petroleum Products**

During the site investigation, no drums or containers of hazardous substances and petroleum products were observed on site.

### **Odors**

No odors were noted on the day of the site visit.

### **Drums and Other Containers**

During the site investigation, no containers or drums were observed in the accessible areas of the building. Small amounts of debris are scattered throughout the site. This debris does not appear to be a potential for environmental concern. However, the debris should be properly disposed in accordance with federal, state and local guidelines.

### **PCBs**

*Polychlorinated Biphenyls* were used as insulating media in electrical equipment for many years, and can be found in many devices still in service today. The EPA has established PCB concentration levels that define whether or not an electrical device is PCB-containing (40 CFR, Part 71). PCBs are toxic coolant or lubrication oils used in some electrical transformers, light ballasts, electrical panels or other similar equipment. The EPA has divided the PCB content in electrical transformers into three categories. Those units which contain less than 50 parts per million (ppm) of PCBs are defined as NON-PCB. Units, which contain between 50 ppm and 500 ppm of PCBs, are defined as PCB-CONTAMINATED. Units with PCB content greater than 500 ppm are classified as PCB-CONTAINING.

## **SECTION III – SITE RECONNAISSANCE**

---

The regulation imposes no duty on the part of a property owner to test for the presence of PCBs in electrical equipment, but requires that, in the absence of evidence to the contrary, all electrical transformers, ballasts and capacitors be considered PCB-containing.

PCBs pose serious health risks and have been shown to produce cancer, damage to reproductive organs and skin lesions. If burned, PCBs give off by-products that are even more toxic than PCBs themselves. They must be handled with caution. Several pole-mounted transformers with a blue “non-PCB” label were observed on along the perimeter of the site. The transformers appear to be in good condition with no signs of leakage or spills. These transformers do not appear to be a potential environmental concern.

### **Asbestos-Containing Materials (ACM)**

Use of asbestos-containing material (ACM) was discontinued in the late 1970s, after the Environmental Protection Agency (EPA) regulated it. A survey addressing ACM was not necessary since the site is comprised of vacant land.

### **Interior and Exterior Surficial Staining or Corrosion and Stressed Vegetation**

No exterior superficial staining or corrosion was noted in the accessible areas. Neither was there any stressed vegetation was observed on the site.

### **Heating and Cooling Systems**

No heating or cooling units were observed at the subject site since it is vacant land.

### **Radon**

The subject property is located in an area known to have radon concentrations well below the Federal (EPA) guideline of 4.0 PicoCuries per liter (pCi/l). According to the Texas Radon database, the average in Harris County is 3.2 pCi/l. Testing for the presence of radon gas was not included in the scope of this Phase I Environmental Site Assessment.

### **Drains and Sumps**

Storm water drains run along Crownwest Drive on the western property line of subject property. No odors, visible sheens or debris were observed on the property. No sumps were observed in the accessible areas.

### **Pits, Ponds or Lagoons**

No pits, pond or lagoons were observed at the subject property or surrounding areas.

## **SECTION III – SITE RECONNAISSANCE**

---

### **Waste Disposal**

There is no waste disposal service on being utilized on the site; residential waste for surrounding properties is handled by the City of Houston.

### **Wastewater Discharges**

No wastewater discharge was observed on-site at the time of the site inspection.

### **Wells**

No water wells were observed on the subject property or the surrounding areas.

### **3.4 Adjoining Properties**

The vicinity of the property can be generally described as residential with some light retail developments in the surrounding area. None of the adjoining properties and surrounding areas is a potential environmental concern to the site.



# SECTION IV

## HISTORICAL SITE BACKGROUND



## SECTION IV – HISTORICAL SITE BACKGROUND

---

### 4.0 Historical Site Background

#### 4.1 Aerial Photographs

Six (6) aerial photographs, (approximate scale 1" = 700') which include the subject property and surrounding area, were obtained from Environmental Data Resources, Inc. which obtains the aerials from the United State Geological Survey (USGS), Agricultural Stabilization & Conservation Service (ASCS), and the Texas Department of Transportation (TXDOT). These photographs were taken in 1944, 1969, 1979, 1989, 1995 and 2004 located in Appendix B.

The following summarizes pertinent information from the aerial photograph review:

AERIAL PHOTOGRAPH SUMMARY		
Date	Source of Aerial	Scale
1944	ASCS	1": 700'
The 1944 aerial photograph shows the subject property as vacant land to be utilized for agricultural purposes. Cook road runs north/south and is the only prominent landmark. Farm structures can be seen through out the photo. Most of the land in the photo appears to be used for agricultural purposes.		
1969	WALLACE ZIN	1": 700'
The 1969 aerial photograph shows the subject property shows the subject property as in the previous aerial photograph. Residential homes in the Catalina Square sub-division can be seen to the east, however the poor quality of photo makes it difficult to distinguish some features.		

## SECTION IV – HISTORICAL SITE BACKGROUND

AERIAL PHOTOGRAPH SUMMARY		
Date	Source of Aerial	Scale
1979	TXDOT	1": 700'
<p>The 1979 aerial photograph shows the subject property now fenced and the water plant structures can be clearly seen under construction to the south. Residential structures now dominate the photograph in all directions surrounding the subject property. The church to the north of the subject property is built and Dairy-Ashford road is now visible.</p>		
1989	TXDOT	1": 700'
<p>The 1989 aerial photograph shows the subject property as in the 1979 aerial photograph. The northern, eastern, southern and western adjoining properties appear as in the 1979 aerial photograph. Construction on the tributary drainage canal that runs east-west has been completed. Residential construction throughout the area progresses.</p>		
1995	USGS	1": 700'
<p>The 1995 aerial photograph indicates some change to the subject property from the previous aerial photograph as the water plant structures are no longer visible. The eastern, southern and western adjoining properties appear as in the 1989 aerial photograph. The school has a new baseball diamond as well as other improvements to the grounds.</p>		
2004	USDA	1": 700'
<p>The subject site appears in the 2004 aerial photograph as it is currently. The fence surrounding the site has been removed. The northern, eastern, southern and western adjoining properties surrounding the site appear as in the 1995 aerial photograph.</p>		

## **SECTION IV – HISTORICAL SITE BACKGROUND**

---

### **4.2 Chain of Title and Historical Ownership**

Review of a present topographical map (appendix C), historical aerial photographs from *circa* 1944 to the present and database reports revealed sufficient history of the subject property and surrounding areas. The site is currently vacant land and is currently owned by City of Houston. The site has been utilized for agricultural purposes, small water plant operations or vacant since at least the early 1940's, according to historical documents reviewed.

Further review regarding the chain of title records was excluded because appropriate levels of inquiry had been accomplished through other sources of information.



# SECTION V

## ENVIRONMENTAL SETTINGS

## SECTION V – ENVIRONMENTAL SETTINGS

---

### 5.0 Environmental Settings

#### 5.1 Topography/Surface Water Conditions

The subject property is approximately 80 feet above mean sea level, and the topography of the subject area is slightly sloping to the east. This information is found on the Alief, Texas 7.5 minute series USGS Quadrangle topographic map presented in Appendix E.

The local drainage of the subject property is south via storm drains along Crownwest Drive. This information was obtained from 1995 “Alief”, Texas” 7.5-minute series USGS Quadrangle topographic maps. A topographical map is presented in Appendix C

#### 5.2 Flood Plain Status

The Federal Emergency Management Agency flood insurance rate map indicates that the subject property is in the un-shaded Zone X, which is an area determined to be outside the 500-year flood plain (See Appendix F). A copy of the FEMA map is presented in Appendix D. 48201C0810 K and 48201C0830 K

#### 5.3 Wetlands

It is not part of this assessment to identify wetlands, but rather to recommend if additional work should be considered based on available information. The subject site exhibits none of the three primary attributes defined by the *Federal Manual for Identifying and Delineating Jurisdictional Wetlands*: (1) the land supports predominantly hydrophytic vegetation; (2) the substrate is predominantly hydric soil; and (3) the substrate is saturated with water to less than 0.5 feet for one week or more during the growing season or exhibits a water table of less than 1.5 feet beneath the surface

#### 5.4 Site Geology

Geologically, the site is mapped as the Beaumont Formation (Qb). Beaumont formations are described as being floodplain deposits, including indistinct low terrace deposits made up of clay, silt, sand, and gravel. Silt and clay deposits are calcareous on the surface and colored dark gray to dark brown with sand being largely quartz. Gravel deposits are siliceous, composed of mostly chert, quartzite, limestone, and petrified wood. The fluvial morphology is well preserved with point bars, oxbows, and abandoned channel segments.

## **SECTION V – ENVIRONMENTAL SETTINGS**

---

This information is found in Appendix G on the Geologic Atlas of Texas, Houston Sheet as prepared by the Bureau of Economic Geology, The University of Texas at Austin.

Ground water flow direction is usually controlled by the top of the unweathered zone, which typically mirrors surface topography. However, local variation in groundwater flow direction occurs due to surface improvements and changes in lithology.

### **5.5 Faults**

The Houston area is known for high angle growth faults and radial faults, which have resulted from subsurface movements of salt domes and soft sediments. Active faults may damage man-made fixed structures such as buildings and roads and are normally recognized by changes in soils and lush vegetation along the fault scarp. The closest faults are the Spring Branch fault five miles to the north east of the subject property. This fault does not appear to cross the subject property or immediately adjoining properties (See Appendix G).

### **5.6 Site Soil Conditions**

According to the “Soil Survey of Harris County, Texas” found in Appendix H and as prepared by the United States Department of Agriculture Soil Conservation Service and Forest Service in cooperation with the Texas Agricultural Experiment Station the subject property is located on Lake Charles clay (LcA).

This is a nearly level soil in broad, irregular areas that are 50 to several hundred areas in size. Slopes average 0,2 percent. Undisturbed areas are characterized by gilgai microrelief, is destroyed in cultivation. In undisturbed areas, a mulch of fine, discrete, very hard aggregates is on the surface.

In the center of microdepressions, the surface layer is about which about 36 inches thick. In the upper 22 inches it is very firm, neutral, black clay. In the lower 14 inches it is very firm, mildly alkaline, very dark gray clay that has intersecting slickensides. The next layer to a depth of 74 inches, is very firm, mildly alkaline, gray clay that is mottled olive brown and yellowish brown. See the soil map presented in Appendix D.

## **SECTION V – ENVIRONMENTAL SETTINGS**

---

### **5.7 Regional Groundwater Conditions**

The public drinking water supply source for the Harris and Harris County area is primarily supplied by Lake Houston and private water wells tapping into the Gulf Coast aquifer.

The Gulf Coast aquifer consists of complex interbedded clays, silts, sands, and gravels of Cenozoic age, which are hydrologically connected to form a large, leaky artesian aquifer system. This system comprises four major components consisting of the Catahoula, the Jasper, the Evangeline and the Chicot aquifers. Maximum total sand thickness ranges from 700 feet in the south to 1,300 feet in the northern extent. Water quality is generally good in the shallower portion of the aquifer. Ground water containing less than 500 mg/l dissolved solids is usually encountered to a maximum depth of 3,200 feet in the aquifer.



# SECTION VI

## REGULATORY REVIEW



## SECTION VI– REGULATORY REVIEW

### 6.0 Regulatory Review

The purpose of the database review is to obtain and review reasonably ascertainable records that will help identify recognized environmental conditions in connection with the site. For this review, records were obtained from TelALL Corporation of Austin, Texas. Regulatory data for facilities with recognized environmental conditions is within the appendices of this report. Remaining regulatory support data will be maintained with ERC project files. A copy of the regulatory database report is attached in Appendix G. The following table indicates the regulated sites identified within particular radii of the subject property, the number of sites, and whether they represent a significant environmental risk.

Database	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
<b>FEDERAL ASTM STANDARD</b>							
NPL	1	0	0	0	0	NR	0
Proposed NPL	1	0	0	0	0	NR	0
CERCLIS	0.5	0	0	0	NR	NR	0
CERC-NFRAP	0.25	0	0	NR	NR	NR	0
CORRACTS	1	0	0	0	0	NR	0
RCRIS-TSD	0.5	0	0	0	NR	NR	0
RCRIS Lg. Quan. Gen.	0.25	0	0	NR	NR	NR	0
RCRIS Sm. Quan. Gen.	0.25	0	0	NR	NR	NR	0
ERNS	TP	NR	NR	NR	NR	NR	0
<b>STATE ASTM STANDARD</b>							
State Haz. Waste	1	0	0	0	0	NR	0
State Landfill	0.5	0	0	0	NR	NR	0
CLI	0.5	0	0	0	NR	NR	0
LUST	0.5	0	0	3	NR	NR	3
UST	0.25	0	0	NR	NR	NR	6
Indian UST	0.25	0	0	NR	NR	NR	0
TX VCP	0.5	0	0	0	NR	NR	0
<b>Notes: NR: Not requested at this search distance</b>							
<b>TP: Target Property</b>							

## **SECTION VI – REGULATORY REVIEW**

---

### **6.1 Federal Database Review**

#### **Federal NPL Site List (MSD-1.0 mile)**

The National Priorities List (Superfund) is EPA's database of uncontrolled or abandoned hazardous waste sites identified for priority remedial actions under the Superfund Program. No NPL sites were listed within one-mile radius of the subject property. The subject property was not listed as an NPL site.

#### **Federal CERCLIS List (MSD-0.5 mile for CERCLIS and NFRAP)**

The Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) identifies facilities for which potential releases of hazardous substances that have been reported under Section 103 or by private citizens. These sites have been investigated or are currently under investigation by EPA. RCRA permitted facilities do not appear on this database, but NPL facilities are typically listed.

No CERCLIS facilities were identified within the search radius of the database report or on the subject property.

#### **Federal RCRA CORRACTS RCRA List (MSD-1.0 mile)**

The Corrective Action Report (CORRACTS) is a compilation of RCRA facilities undergoing corrective action. A corrective action order is issued pursuant to RCRA Section 3008(h) when there has been a release of hazardous waste or constituents into the environment from a RCRA facility. Corrective actions may be required beyond the facility's boundary and can be required regardless of when the release occurred. No RCRA CORRACTS sites were identified within 1.0 mile of the subject property. The subject property was not listed as a RCRA CORRACTS facility.

#### **Federal RCRA TSD Site (MSD – 0.5 mile)**

The EPA's Resource Conservation and Recovery Act (RCRA) Program identifies and tracks hazardous waste from the point of generation to the point of disposal. The RCRA Treatment, Storage, and Disposal (TSD) facilities database is a compilation of reporting facilities that perform treatment, storage or disposal (TSD) of hazardous waste. No RCRA TSD sites were located within 0.5 mile of the subject property. The subject property was not listed as a RCRA TSD facility.

## **SECTION VI – REGULATORY REVIEW**

---

### **Federal RCRA Generators (MSD <1/4 for SQG & LQG)**

Facilities listed in the Resource Conservation and Recovery Act (RCRA) database are designated Small or Large Quantity Generators (SQG / LQG) that report hazardous waste generated and disposed. No RCRA generators were identified within 0.25 mile of the subject property. The subject property and adjoining properties were not listed as RCRA generators.

### **Federal ERNS List (MSD-Subject Property)**

A review of the ERNS database was conducted to identify reported releases of oil and of hazardous substances on or adjacent to the site. The database contains information from spill reports made to federal agencies including the EPA, the U.S. Coast Guard, the National Response Center, and the DOT. No ERNS sites were reported according to the TelALL database at the subject property or on the adjoining properties.

## **6.2 State Database Review**

### **State Superfund Sites (MSD-1.0 mile)**

The Texas Hazardous Waste Sites List is a compilation of those sites that the State has received notification of a release of hazardous wastes, including NPL sites, CERCLIS sites, and non-Federally regulated hazardous waste release sites. No THWS facilities were identified within the 1.0-mile search radius and on the subject property.

### **State Solid Waste Disposal Facility Listings (MSD-0.5 mile)**

The Texas Solid Waste Landfill (SWLF) list is a compilation of landfills and solid waste disposal sites permitted by the State. No TXLF facilities were identified within the 0.5-mile search radius and on the subject property.

### **State Closed Landfill Sites (MSD-0.5 mile)**

The Texas Commission on Environmental Quality (TCEQ) maintains a database of closed and abandoned landfills including permitted as well as unauthorized across the state of Texas. According to the TelALL database, there are no CLS located within the search radius of 0.5 mile and on the subject property.

## **SECTION VI – REGULATORY REVIEW**

---

### **State Registered Leaking Underground Storage Tank Listings (MSD-0.5 mile)**

Three (3) TXLUST facilities were identified within the search radius. According to the TelALL database report, the former Diamond Shamrock 2502, located at 7621 Cook Road, is approximately .17 miles southeast and down gradient in respect to the subject property. The release was reported on March 9, 1998. According to TCEQ, groundwater was impacted. Also identified was the Stop and Go 3554 located at 7621 Cook Road, which is approximately 0.17 miles southeast and down gradient in respect to the subject property. The release was reported on August 28, 1990. According to TCEQ, groundwater was impacted. TCEQ issued a final concurrence and closed the case. Lastly, Reliant Energy Entex West Dist. was identified. It is located at 12330 Bellaire, it is approximately 0.38 miles northeast and cross gradient in respect to the subject property. The release was reported on December 13, 1993. According to TCEQ, no groundwater was impacted. TCEQ issued a final concurrence and closed the case. Due to the distance from the subject property and the status of the facility, no potential for environmental concern to the subject property is anticipated.

### **State Registered TXUST listings (MSD-0.25 mile)**

This database is maintained as a source of UST's registered by the TCEQ. Six (6) TXUST sites were reported within the search radius. There are no reported violations according the TXUST database. Due to the distance and the hydrologic position from the subject property, there is no potential environmental concern to the subject property.

### **Texas Indian Underground Storage Tank Sites (MSD-0.25 mile)**

This database is maintained as a source of USTs registered on Indian land by the EPA Region 6. No sites were identified with the search radius or on the subject property.

### **Texas Voluntary Cleanup Program Sites (MSD-0.5 mile)**

The Texas Voluntary Cleanup Program was established to provide administrative, technical and legal incentives to encourage the cleanup of contaminated sites in Texas. No VCP facilities were identified within the search radius or on the subject property.

### **State Spills List (MSD-Subject Property)**

No TXSPILL sites were identified at the subject property.

## SECTION VI – REGULATORY REVIEW

### 6.3 Additional Environmental Record Sources

The number of listed sites identified within the approximate minimum search distance (AMSD) from review of environmental record sources beyond those specified in ASTM Standard E 1527-00 § 7.2.1.1 are summarized in the following table. Detailed information for sites identified within the AMSDs is provided following the table, along with an opinion about the significance of the listing to the analysis of recognized environmental conditions in connection with the subject property. Pertinent copies of research information are included in Appendix G.

Database	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
<b>FEDERAL ASTM SUPPLEMENTAL</b>							
CONSENT	1	0	0	0	0	NR	0
ROD	1	0	0	0	0	NR	0
Delisted NPL	1	0	0	0	0	NR	0
FINDS	TP	0	NR	NR	NR	NR	0
HMIRS	TP	NR	NR	NR	NR	NR	0
MLTS	TP	NR	NR	NR	NR	NR	0
MINES	0.25	0	0	NR	NR	NR	0
NPL Liens	TP	NR	NR	NR	NR	NR	0
PADS	TP	NR	NR	NR	NR	NR	0
Indian Reservation	1	0	0	0	0	NR	0
UMTRA	0.5	0	0	0	NR	NR	0
US ENG Controls	0.5	0	0	0	NR	NR	0
ODI	0.5	0	0	0	NR	NR	0
FUDS	1	0	0	0	0	NR	0
DOD	1	0	0	0	0	NR	0
RAATS	TP	NR	NR	NR	NR	NR	0
TRIS	TP	NR	NR	NR	NR	NR	0
TSCA	TP	NR	NR	NR	NR	NR	0
SSTS	TP	NR	NR	NR	NR	NR	0
FTTS	TP	NR	NR	NR	NR	NR	0
<b>STATE OR LOCAL ASTM SUPPLEMENTAL</b>							
AST	TP	NR	NR	NR	NR	NR	0
TX Spills	TP	NR	NR	NR	NR	NR	0
IOP	TP	NR	NR	NR	NR	NR	0
Dry Cleaners	0.25	0	0	NR	NR	NR	0
ED AUQUIF	TP	NR	NR	NR	NR	NR	0
ENF	TP	NR	NR	NR	NR	NR	0
Ind. Haz Waste	TP	NR	NR	NR	NR	NR	0
WasteMgt	TP	NR	NR	NR	NR	NR	0
AIRS	TP	NR	NR	NR	NR	NR	0
<b>TelALL PROPRIETARY HISTORICAL DATABASES</b>							
Coal Gas	1	0	0	0	0	NR	0
Brownfield Databases							
US Brownfields	0.5	0	0	0	NR	NR	0
Brownfields	0.5	0	0	0	NR	NR	0
AUL	0.5	0	0	0	NR	NR	0
TXVCP	0.5	0	0	0	NR	NR	0

Notes: NR: Not requested at this search distance

TP: Target Property

Sites may be listed in more than one database

## **SECTION VI – REGULATORY REVIEW**

---

No sites were identified within the approximate minimum search distance for the additional environmental record sources reviewed.

### **Local Regulatory Agencies**

No records of environmental complaints or violations were reported for the subject property or adjoining properties by the Harris Health District, Harris County Air Pollution Control or City of Houston Fire Department.

# SECTION VII

## FINDINGS

## SECTION VII – FINDINGS

---

### 7.0 Findings

Environmental Resource Consultants (ERC) has performed a Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM Practice E 1527 of the subject property of the 14,400 sq. ft. of vacant land located at 7300 Crownwest Drive in Houston, Harris County, Texas. Any exceptions to, or deletions from, this practice are described in Section 2.0 of this report. This assessment has revealed the following evidence of recognized environmental conditions in connection with the subject property:

- The subject property is located at 7300 Crownwest Drive in Houston, Texas. The subject site consists of approximately 14,400 sq. ft. of land covered with native vegetation. The site is currently vacant and historically been utilized for a water treatment plant and agricultural purposes previous to that. The site is unfenced.
- During the site investigation, no containers, drums, and hazardous substance or petroleum products were observed. Also no hazardous wastes site appeared at the site. Small amounts of debris are located on the site. It is recommended that these areas be cleaned up and disposed in accordance to federal, state and local guidelines.
- A review of available federal, state, and local agency records revealed three (3) Leaking Underground Storage Tank sites within a 0.5 mile radius of the subject property, and six (6) Texas Underground Storage Tank facilities within a 0.25-mile radius of the subject. According the TelALL database records, and visual site inspection, none of the sites listed pose a potential environmental concern to the subject property.
- Three (3) TXLUST facilities were identified within the search radius. According to the TelALL database report, the former Diamond Shamrock 2502, located at 7621 Cook road, is approximately .17 miles southeast and down gradient in respect to the subject property. The release was reported on March 9, 1998. According to TCEQ, groundwater was impacted. Also identified was the Stop and Go 3554 located at 7621 Cook Road, which is approximately 0.17 miles southeast and down gradient in respect to the subject property. The release was reported on August 28, 1990. According to TCEQ, groundwater was impacted. TCEQ issued a final concurrence and closed the case. Lastly, Reliant Energy Entex West Dist. was identified. It is located at 12330 Bellaire, it is approximately 0.38 miles northeast and cross gradient in respect to the subject property. The release was reported on December 13, 1993. According to TCEQ, no groundwater was impacted. TCEQ issued a final concurrence and closed the case. Due to the distance from the subject property and the status of the facility, no potential for environmental concern to the subject property is anticipated.



## **SECTION VII – FINDINGS**

---

- This database is maintained as a source of UST's registered by the TCEQ. Six (6) TXUST's were reported within the search radius. There are no reported violations according the TXUST database. Due to the distance and the hydrologic position from the subject property, there is no potential environmental concern to the subject property.



# SECTION VIII

## CONCLUSIONS & RECOMMENDATIONS

## **SECTION VIII – CONCLUSIONS AND RECOMMENDATIONS**


---

### **8.0 Conclusions and Recommendations**

Based on the site visit and research conducted at the local and state level regarding the subject property including historical sources, it appears there is minimal potential for environmental concerns to the subject property and no further investigation is warranted.

# APPENDIX A

## SITE MAPS

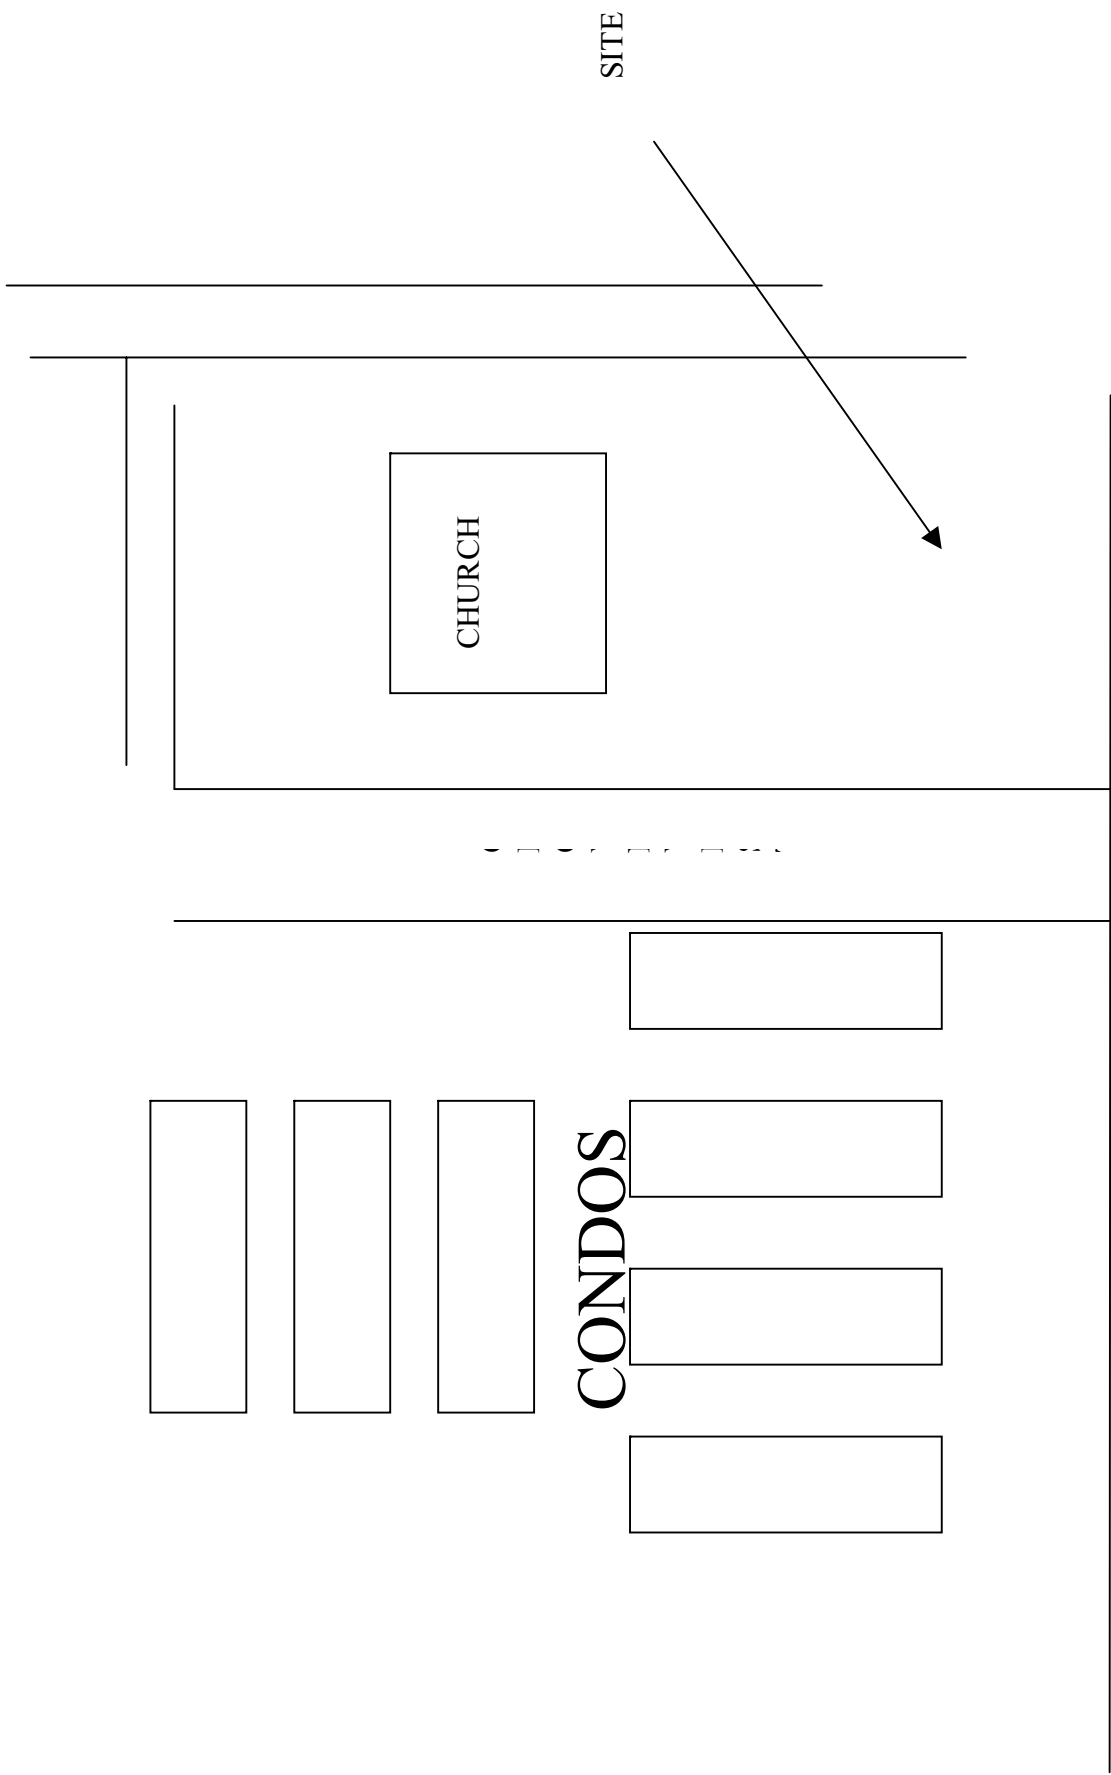

CONDOS

CHURCH

SITE MAP  
NOT TO SCALE

APARTMENTS


SITE

# APPENDIX B

## AERIAL PHOTOGRAPHS



**Parcel No: S95-046  
14,400 sq. ft. of Vacant Land  
7300 Crownwest Drive  
Houston, Texas**

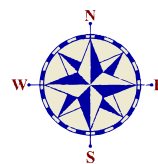


**1944 Aerial  
Photograph**






**Parcel No: S95-046**  
**14,400 sq. ft. of Vacant Land**  
**7300 Crownwest Drive**  
**Houston, Texas**

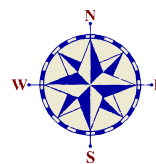


**1969 Aerial**  
**Photograph**



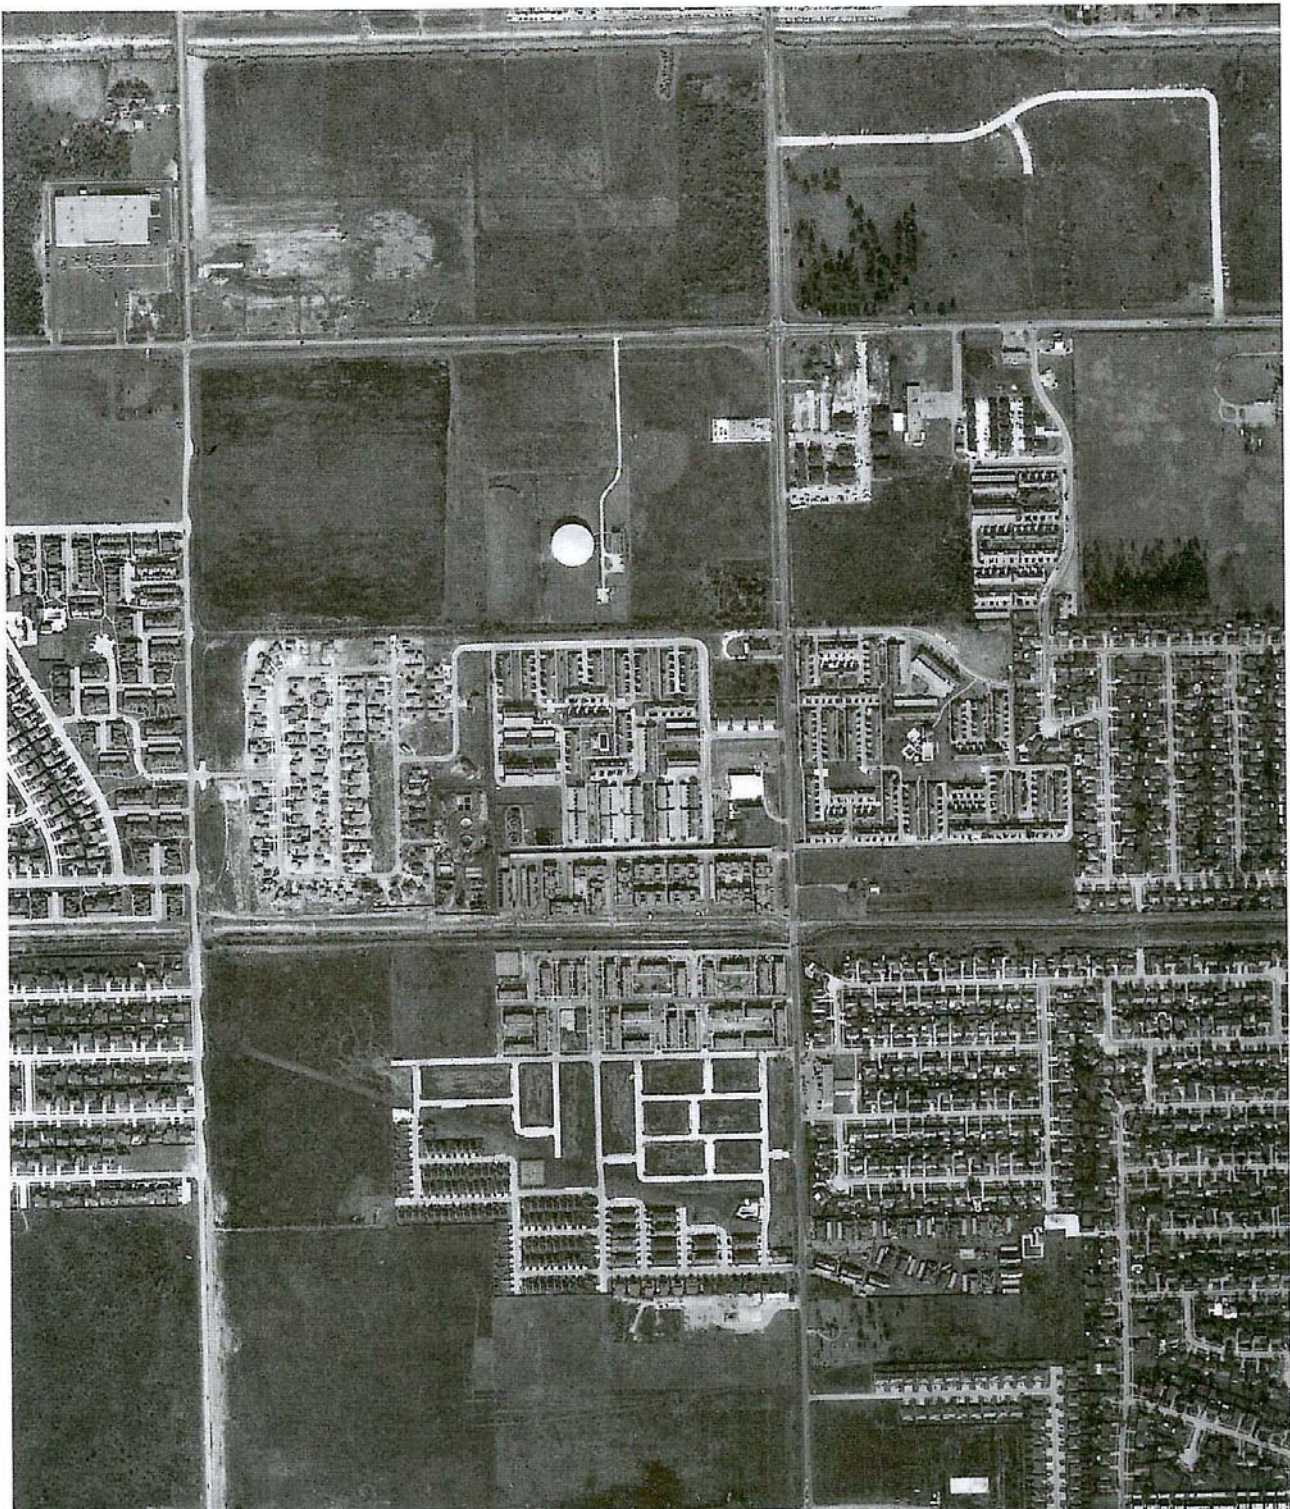

Parcel No: S95-046  
14,400 sq. ft. of Vacant Land  
7300 Crownwest Drive  
Houston, Texas

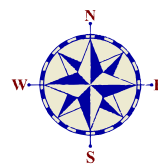


1979 Aerial  
Photograph





**Parcel No: S95-046**  
**14,400 sq. ft. of Vacant Land**  
**7300 Crownwest Drive**  
**Houston, Texas**

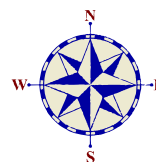


**1989 Aerial  
Photograph**





**Parcel No: S95-046**  
**14,400 sq. ft. of Vacant Land**  
**7300 Crownwest Drive**  
**Houston, Texas**

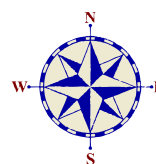


**1995 Aerial  
Photograph**






**Parcel No: S95-046**  
**14,400 sq. ft. of Vacant Land**  
**7300 Crownwest Drive**  
**Houston, Texas**

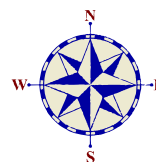


**2004 Aerial  
Photograph**

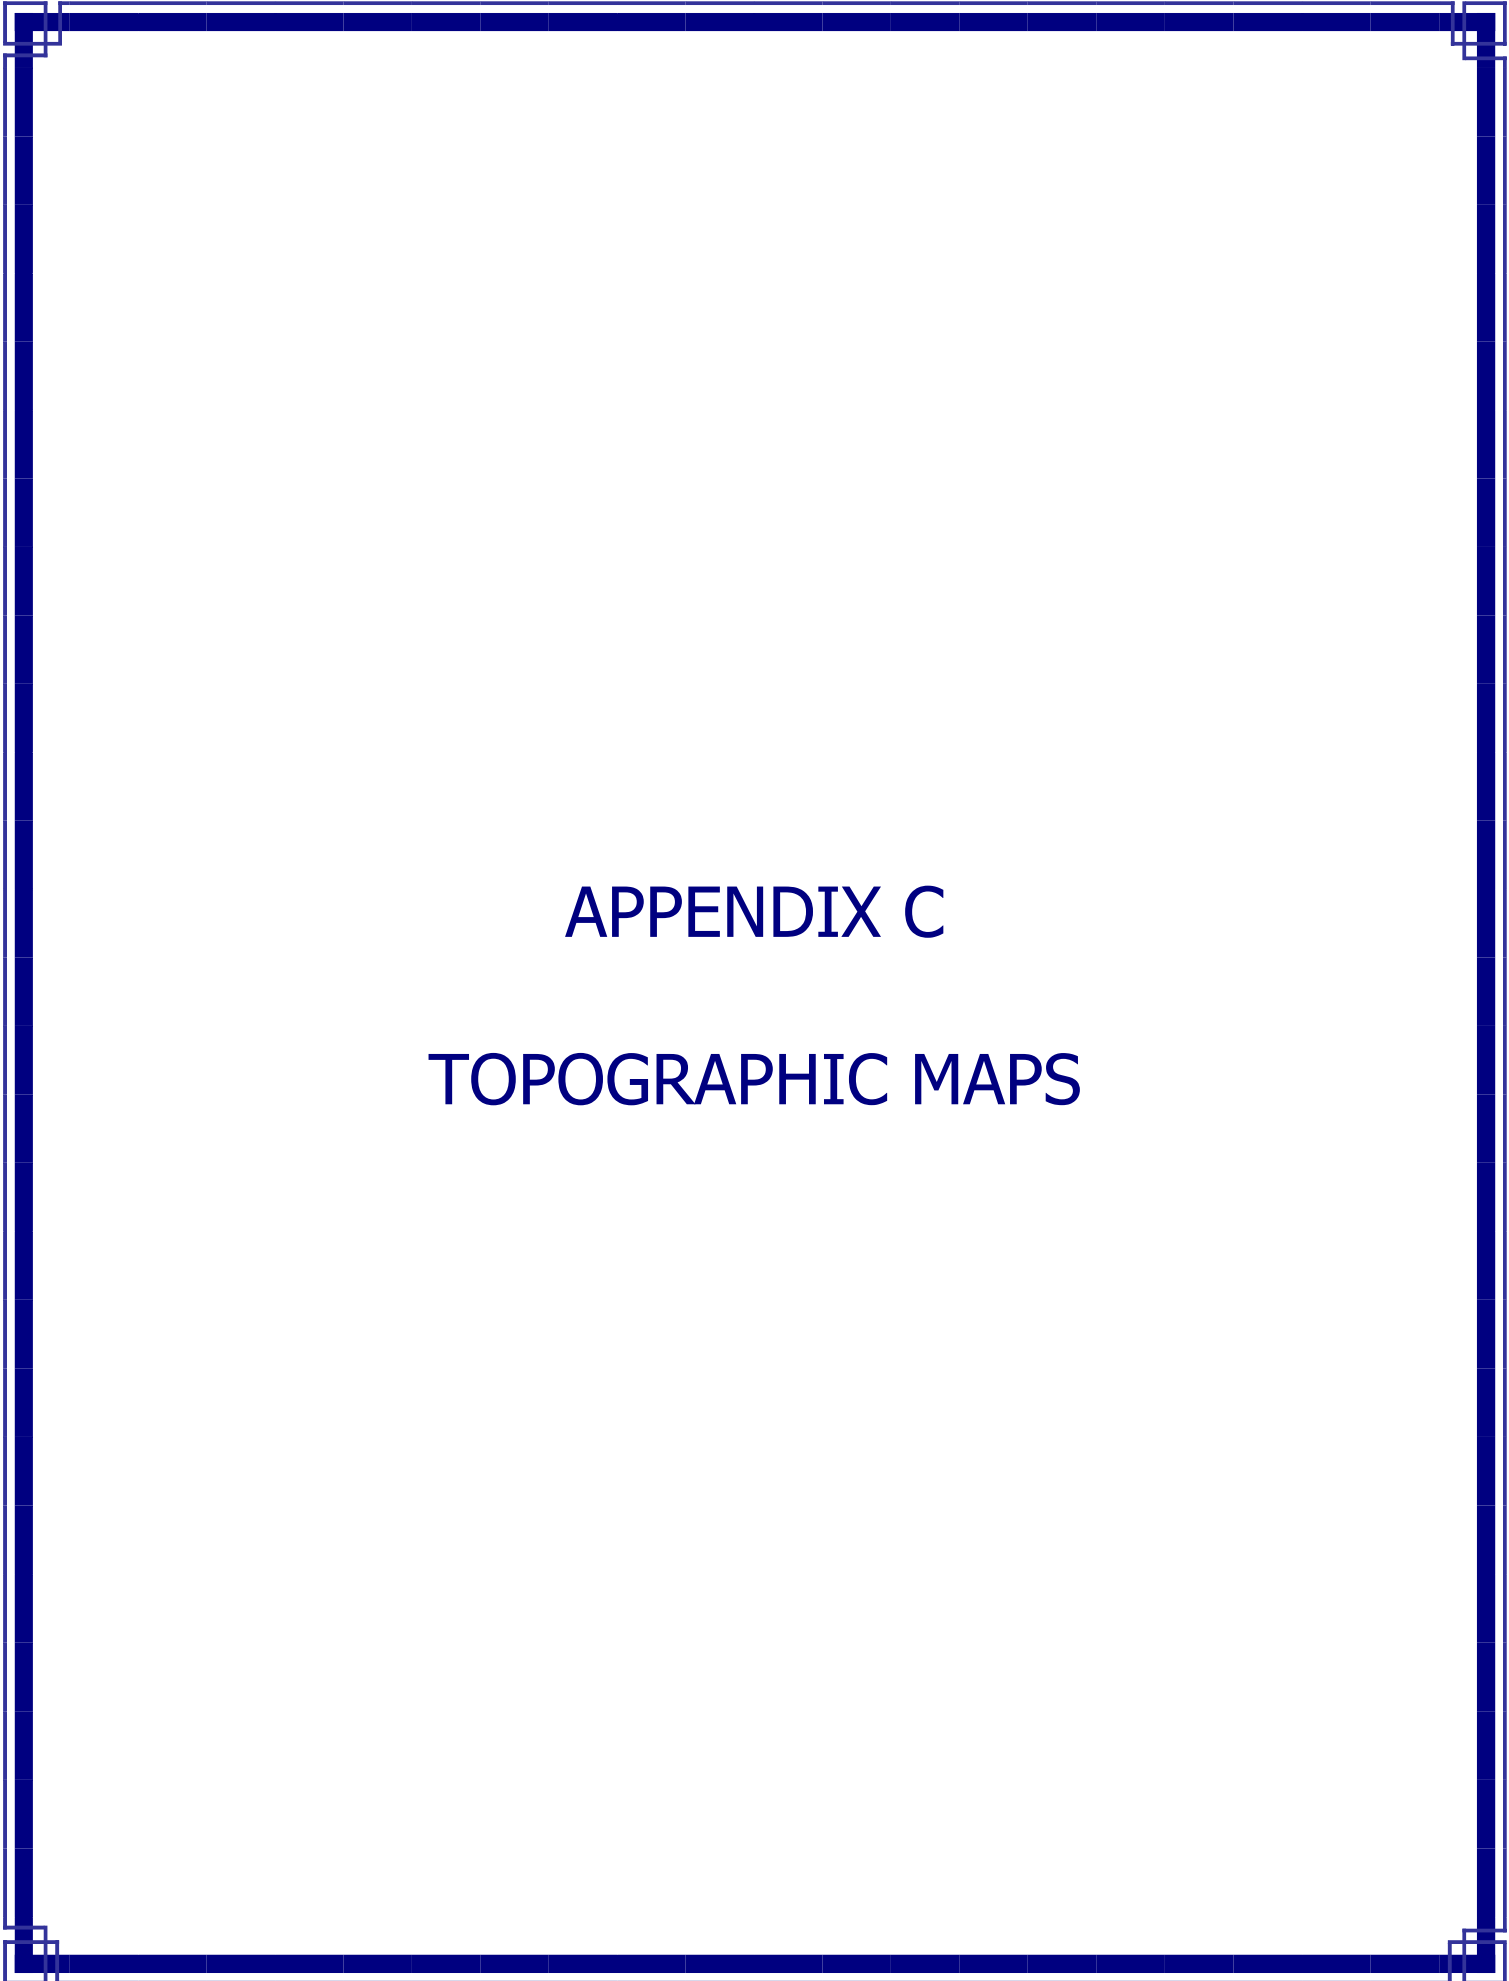

# APPENDIX C

## TOPOGRAPHIC MAPS



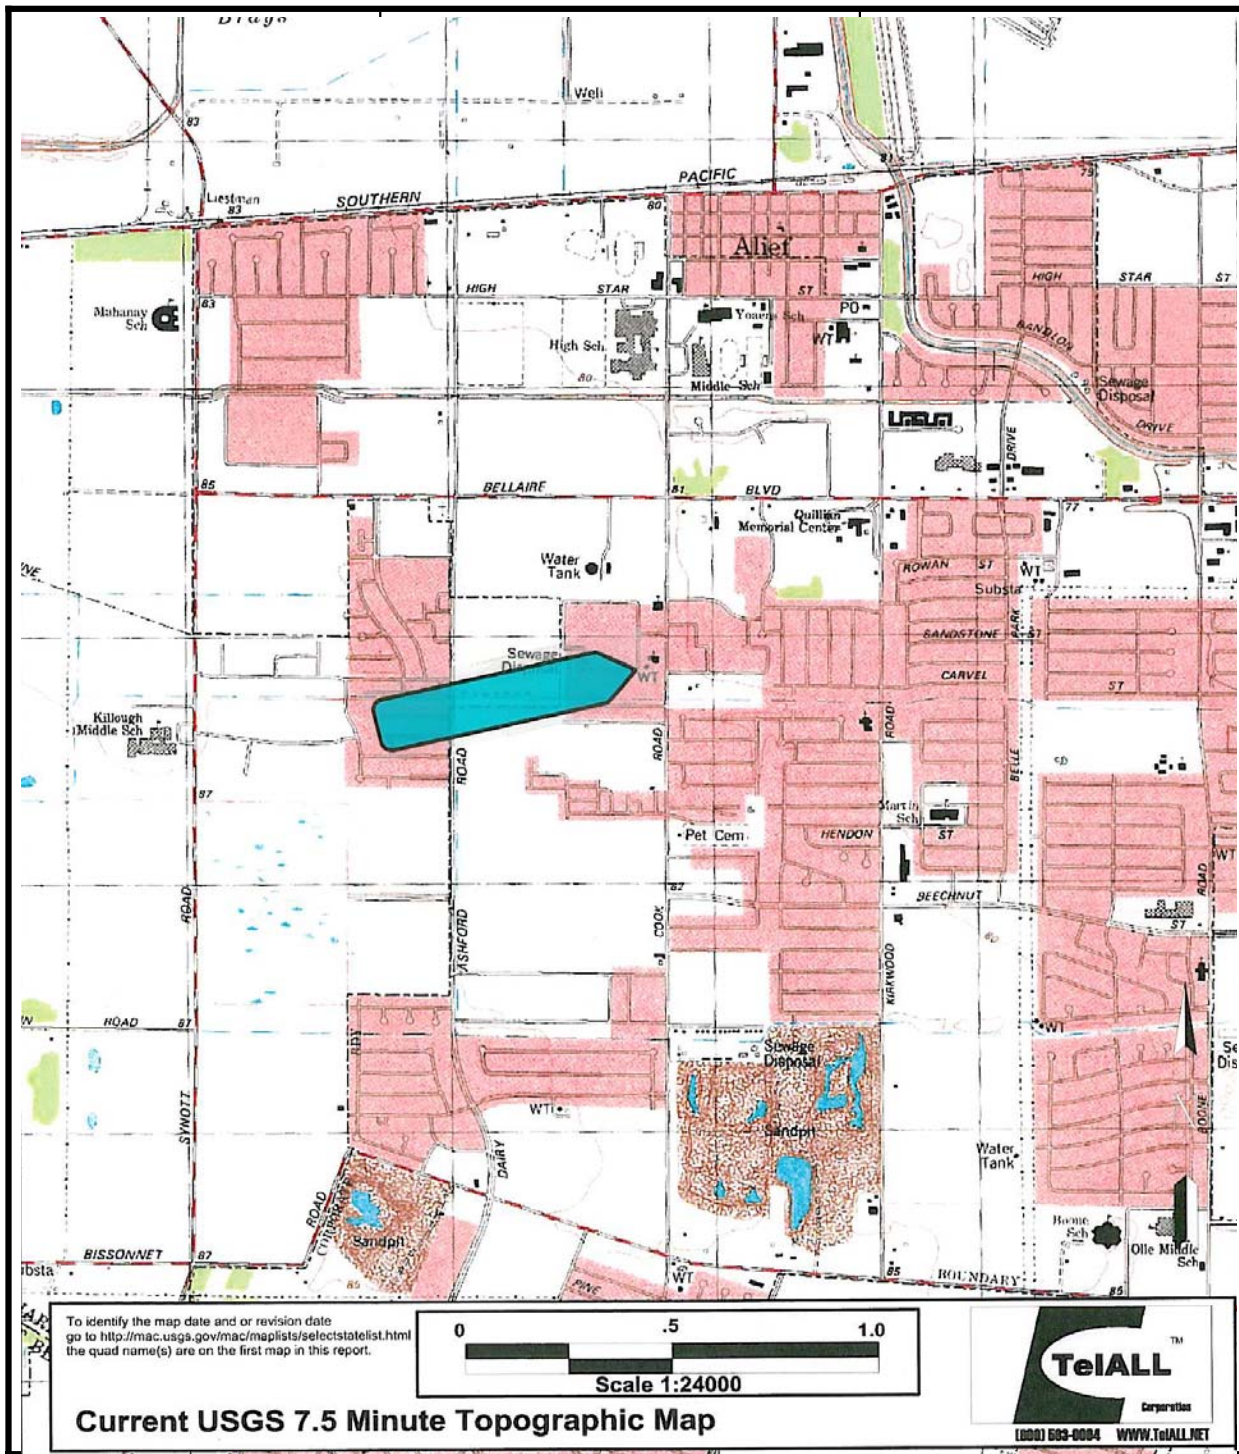

**ERC**


City Of Houston  
 Parcel No: S95-046  
 7300 Crownwest Drive  
 Houston, Texas

Topography Map

# APPENDIX D

## MAPS



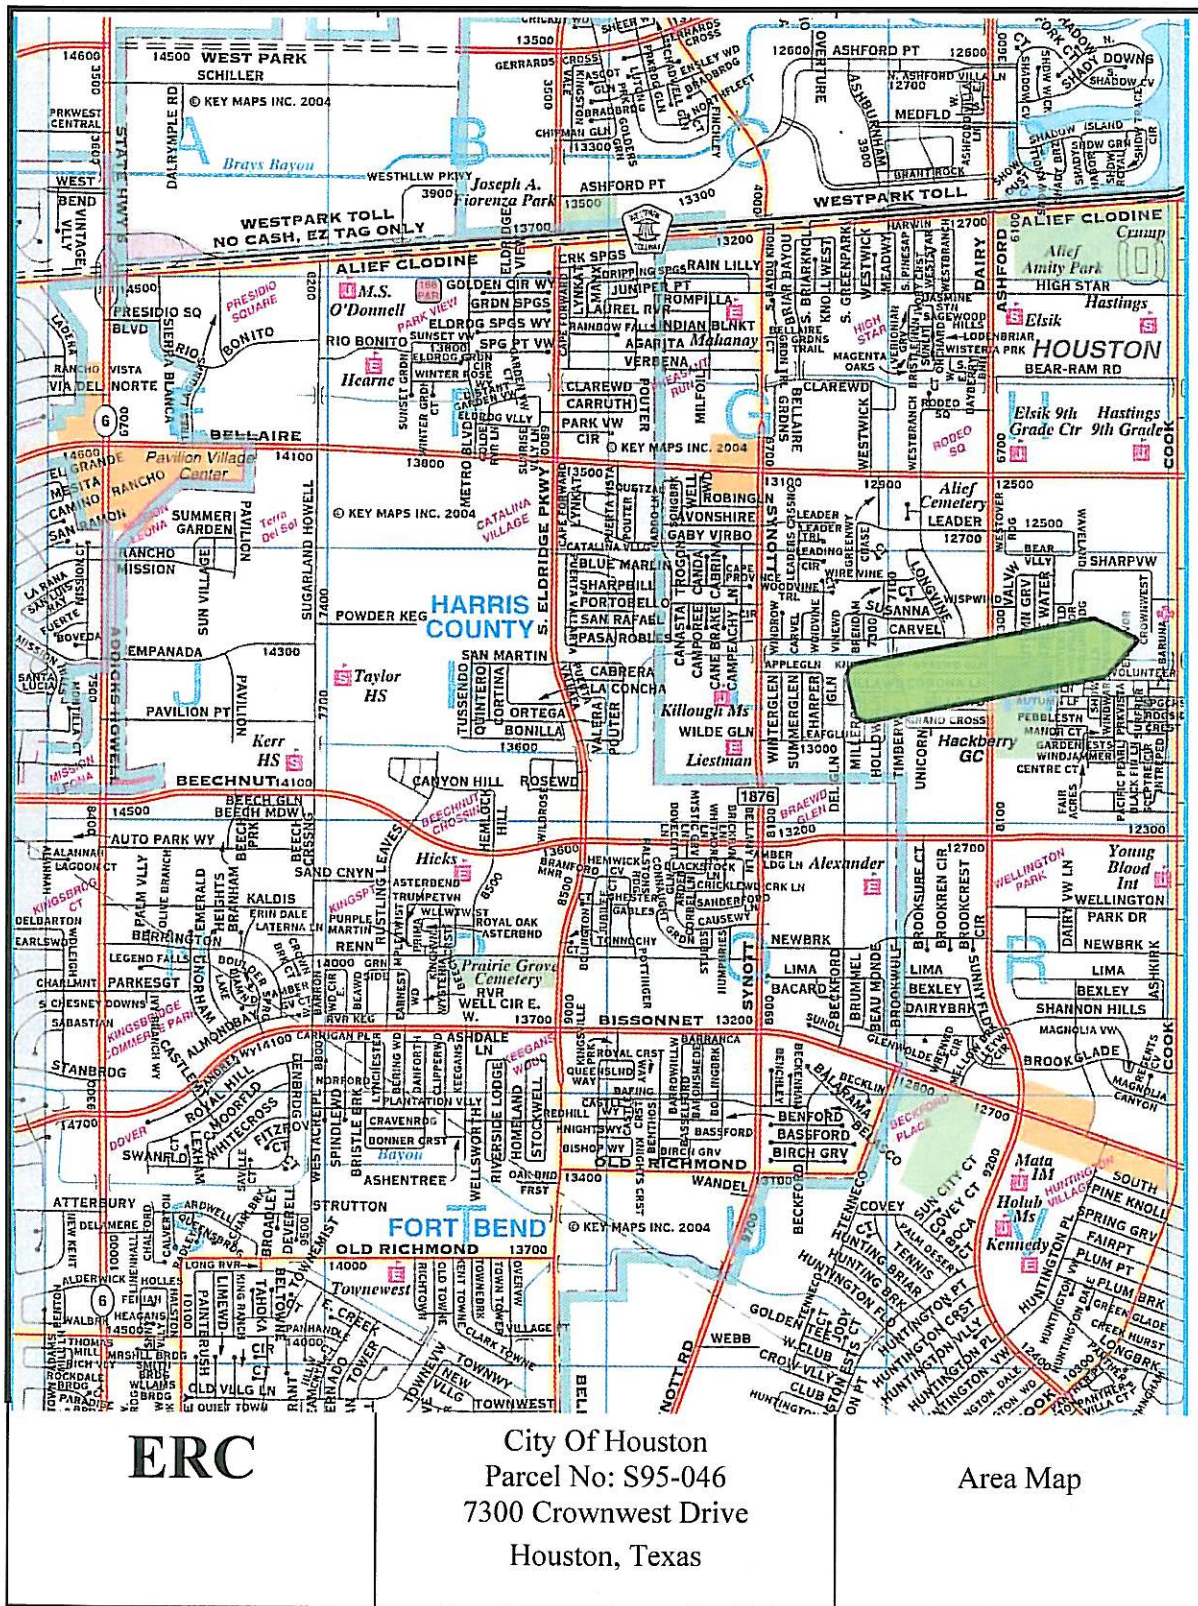


ERC

City of Houston  
Parcel No: S95-046  
7300 Crownwest Drive  
Houston, Texas

Area Map



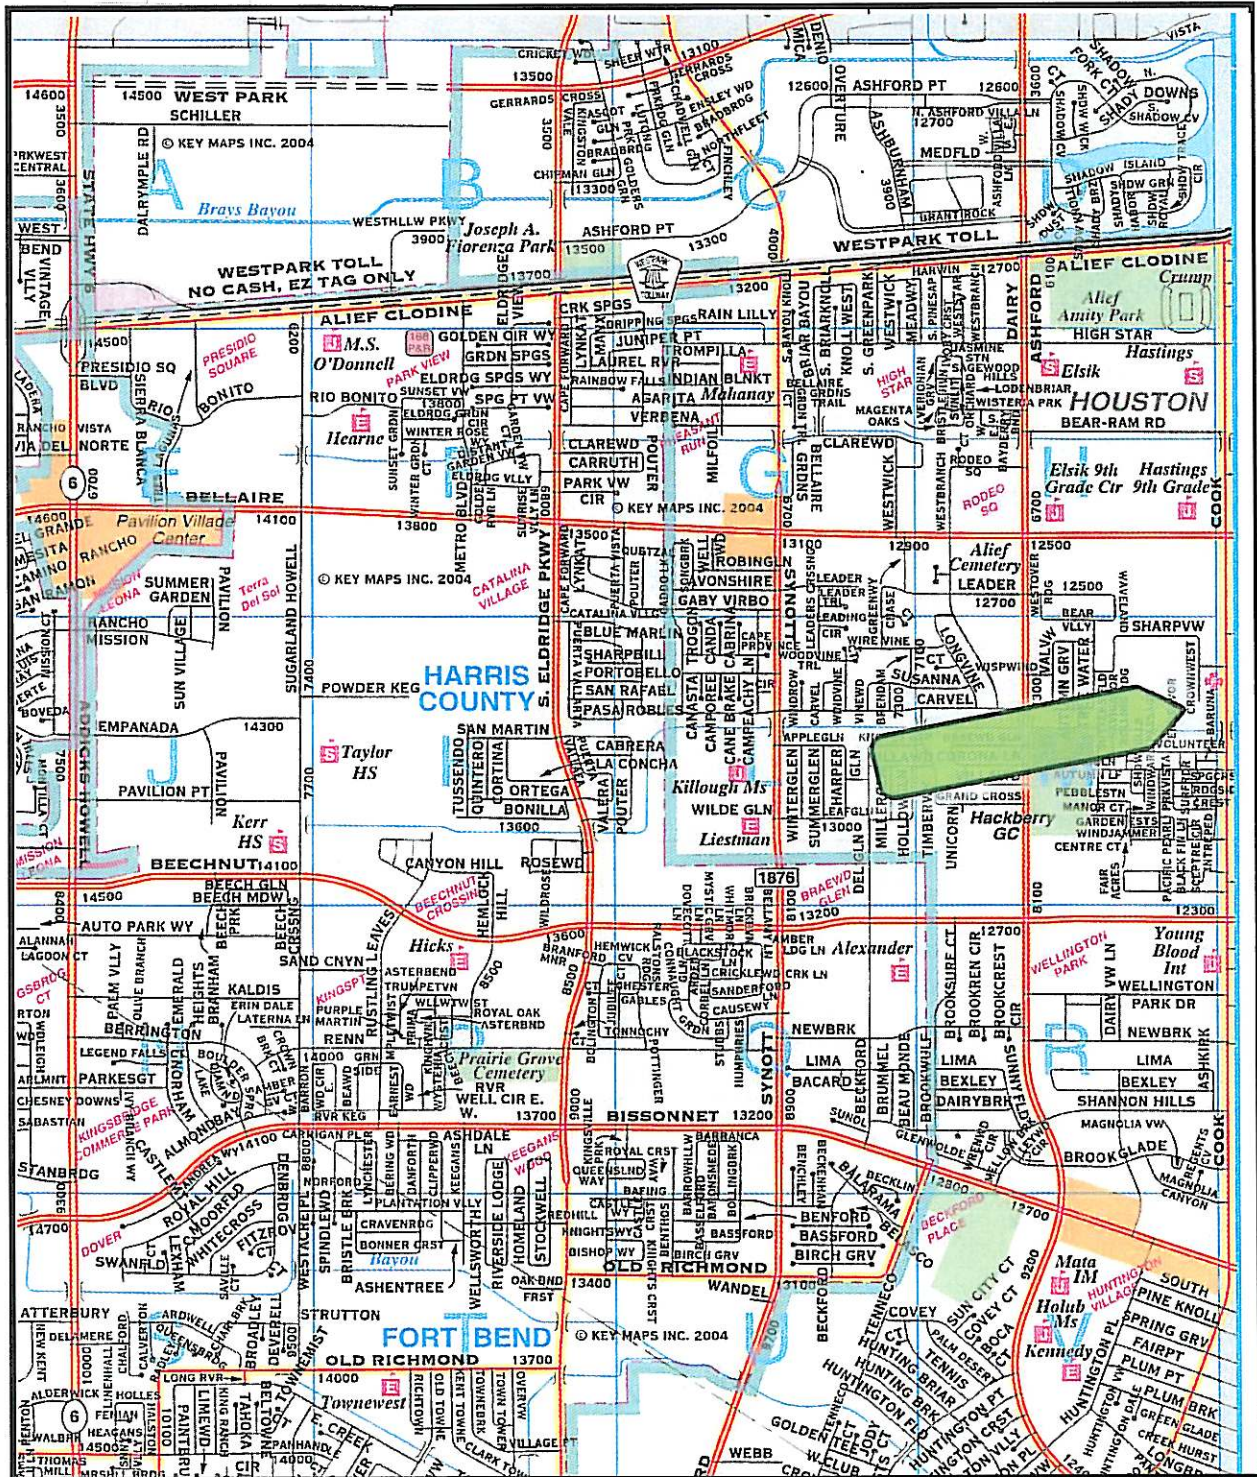


**ERC**

City Of Houston  
Parcel No: S95-046  
7300 Crownwest Drive  
Houston, Texas

Neighborhood Map



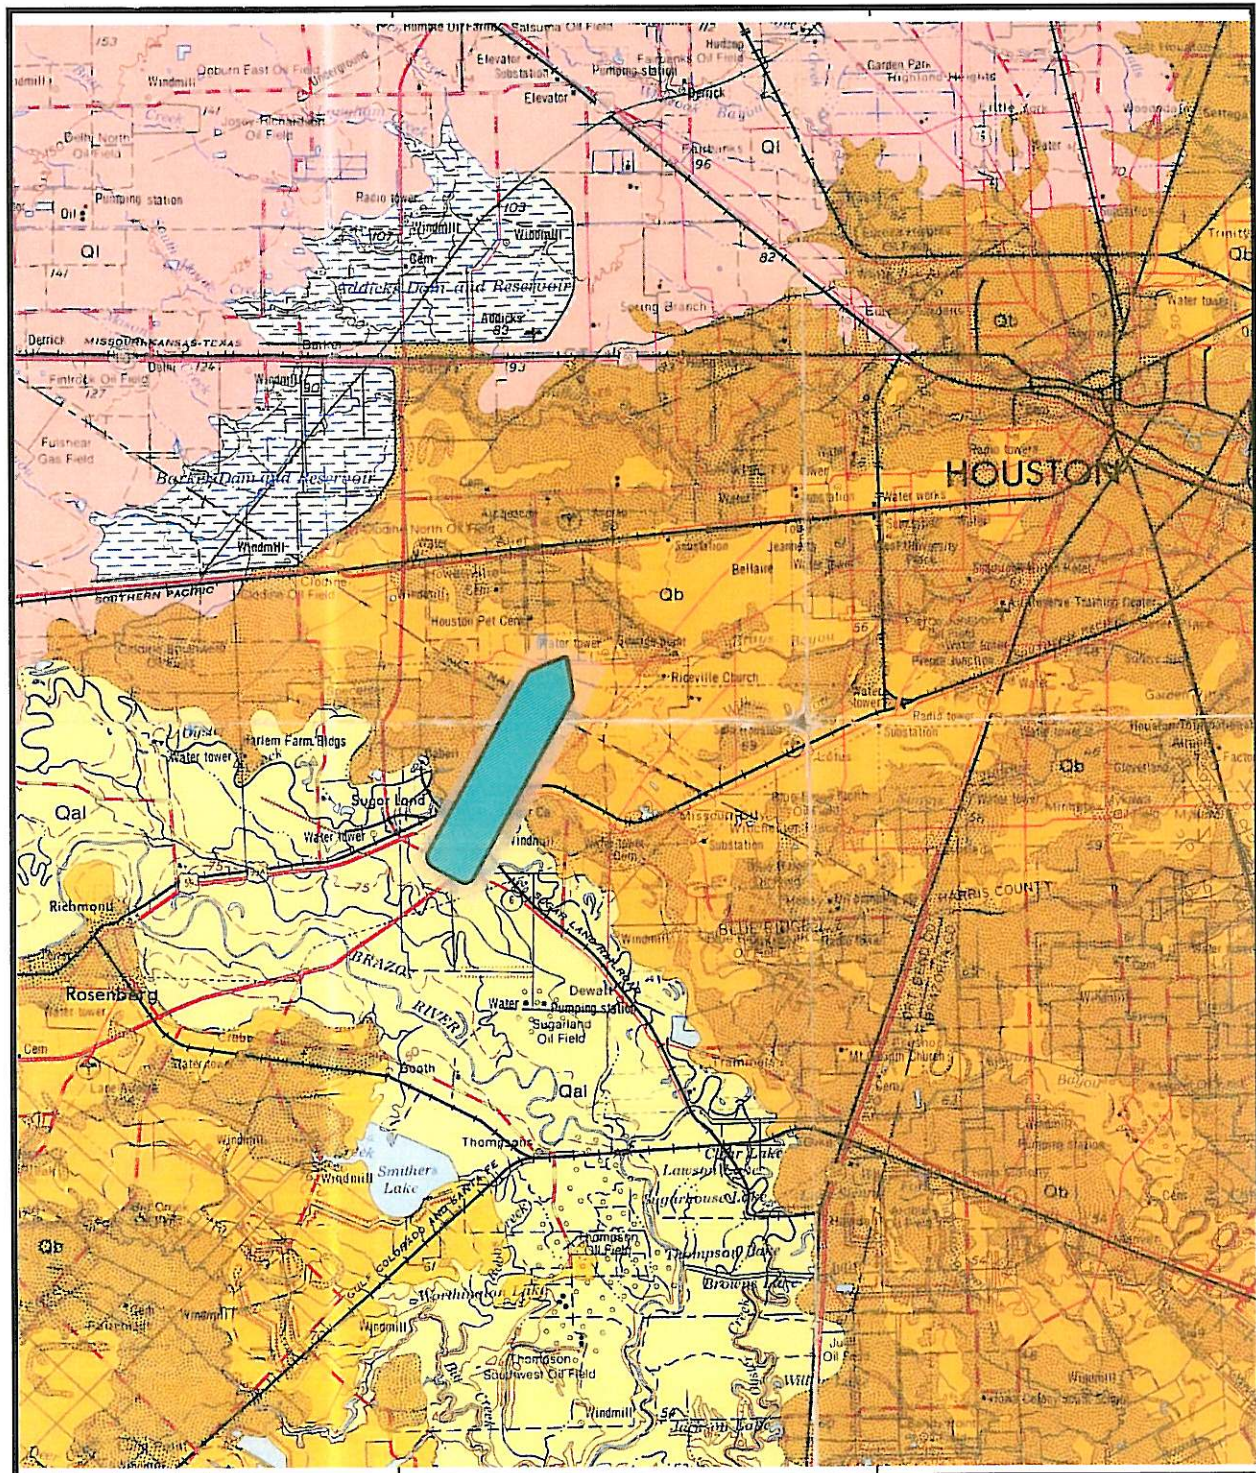



**ERC**

City Of Houston  
Parcel No: S95-046  
7300 Crownwest Drive  
Houston, Texas

Geologic Atlas  
Texas Map



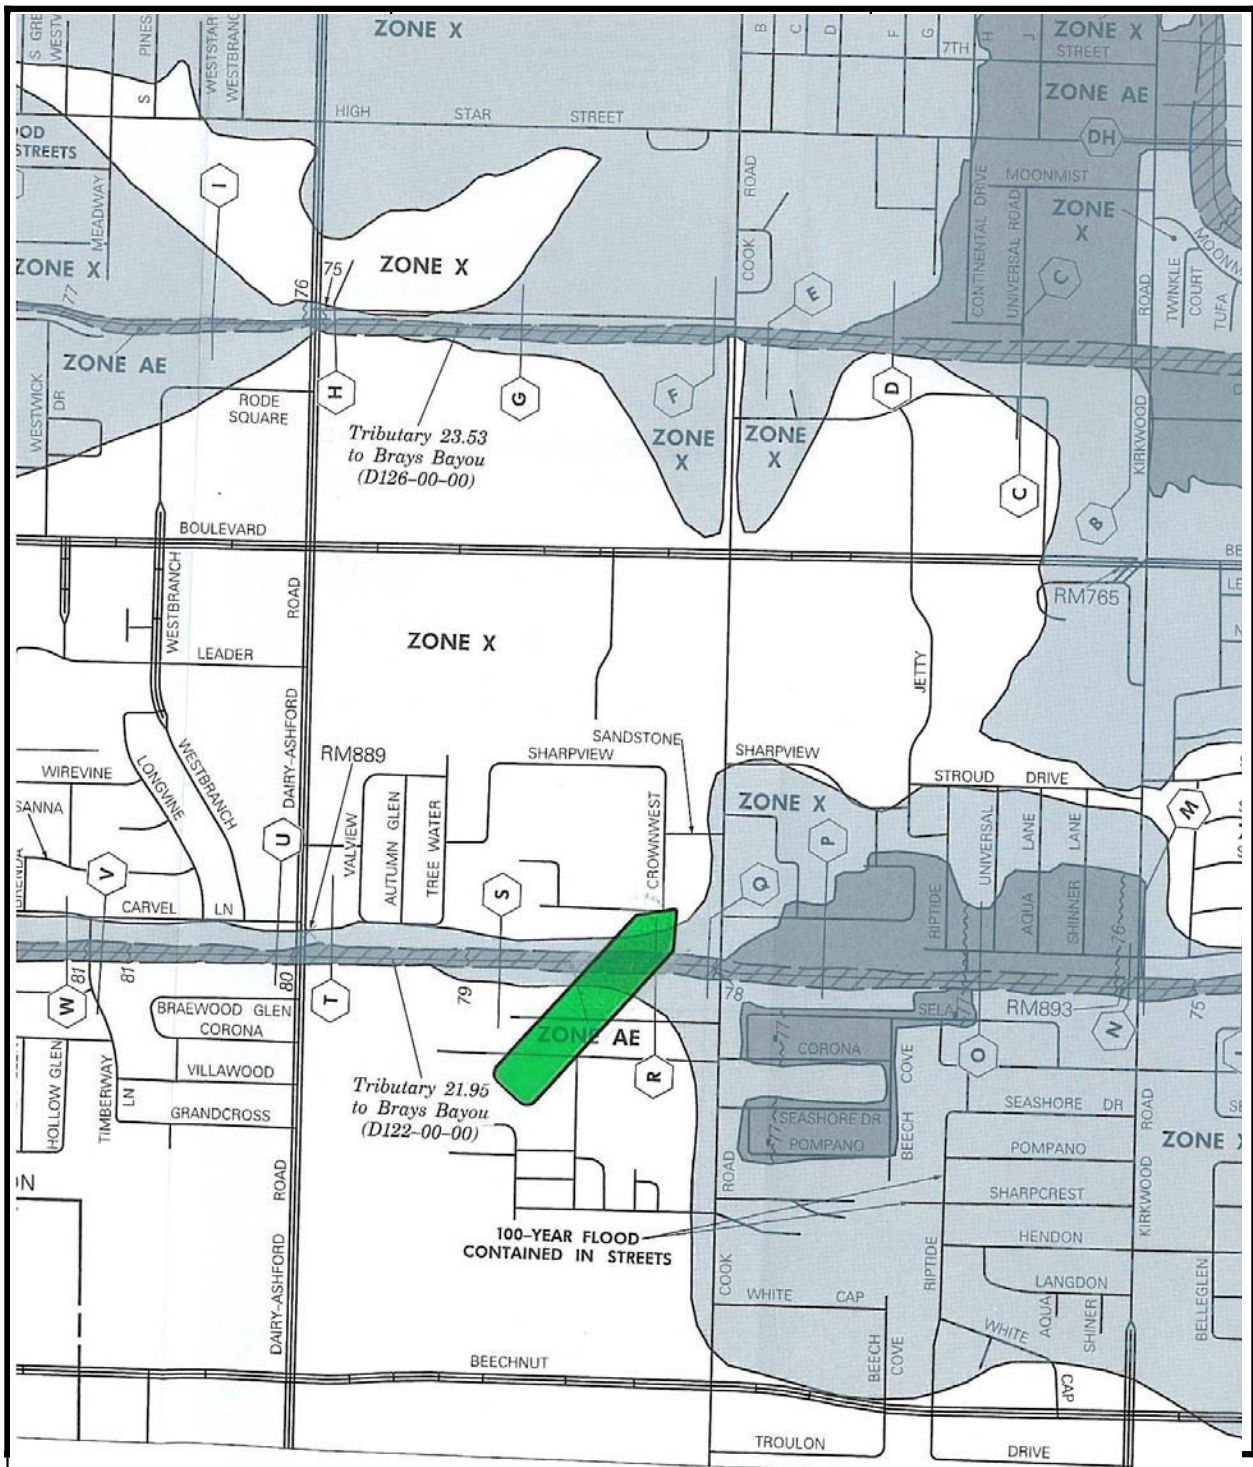

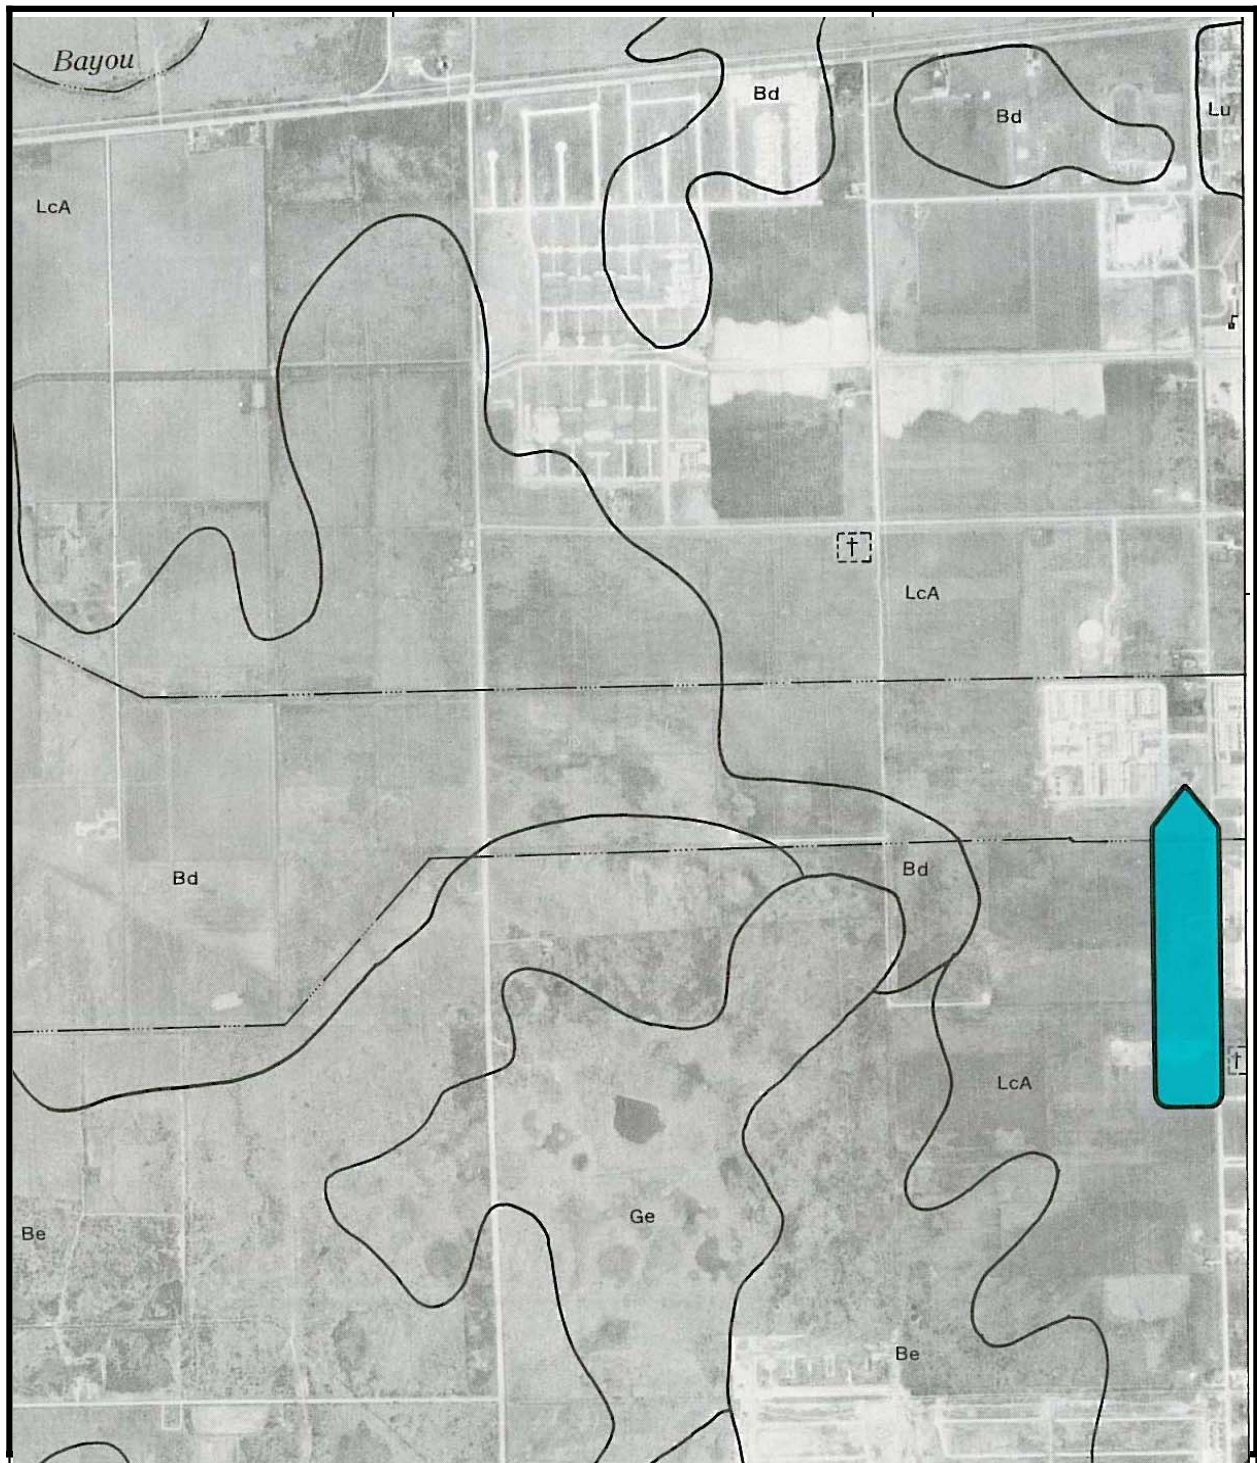

**ERC**

City Of Houston  
Parcel No: S95-046  
7300 Crownwest Drive  
Houston, Texas

Soil Map

# APPENDIX E

## PHOTOGRAPHS





Looking west from Crownwest across subject property.



Looking northeast from across subject property.



Looking southeast across subject property toward apartments.



Looking northwest from subject property western property line.



Chapel of Praise Church north of subject property.





# APPENDIX F

## PROPERTY RECORDS

NOT INCLUDED  
IN THIS  
PHASE I  
ENVIRONMENTAL  
SITE  
ASSESSMENT

# APPENDIX G

## GOVERNMENT DATABASE REPORT



# **Environmental Data Search**

for the site

**Phase I ESA City Water Parcels  
7300 Block Crownwest Drive, Houston, TX**

**0604161**

performed for

**ERC**

4/25/2006

ERIC6720

**[www.TelALL.net](http://www.TelALL.net)**

---

(800) 583-0004 by fax (512) 472-4466

## Preface

This document of environmental concerns near 7300 Block Crownwest Drive, Houston, TX reports findings of the TelALL data search, prepared on the request of ERC.

TelALL Corporation (TelALL) has designed this document to comply with the ASTM standard E 1527 - 00 sec.7.1.3 (Accuracy and Completeness) and has used all available resources but makes no claim to the entirety or accuracy of the cited government records. Our databases are updated at least every 90 days or as soon as possible after publication by the referenced governmental agencies (ASTM 1527 - 00 sec. 7.1.7). The following fields of governmental databases may not represent all known, unknown or potential sources of contamination to the referenced site. Many different variables effect the outcome of the following document. TelALL maintains extremely high standards, and stringent procedures that are used to search the referenced data. However, TelALL reserves the right at any time to amend any information related to this report.


If there is a need for further information regarding this report, or for any customer support please call TelALL at 800 583-0004 for assistance.

This report is divided into the following components:

- MAP** Identified geocodeable findings relative to this data search.
- SUMMARY 1** Sorting of the identified sites by distance from the subject site.
- FINAL** A description of each database and a detailed explanation of findings.

## Sources

Database	Acronym	Last Updated	Minimum Search Distance	Findings
National Priority List	NPL	10/2005	1	0
Comprehensive Environmental Response, Compensation, and Liability Information System	CERCLIS	03/2006	0.5	0
No Further Remedial Action Planned	NFRAP	03/2006	0.5	0
Resource Conservation and Recovery Information System - Treatment Storage or Disposal	RCRA TSD	03/2006	1	0
Corrective Action	CORRACT	03/2006	1	0
Resource Conservation and Recovery Information System - Generators	RCRA-G	03/2006	0.25	0
Emergency Response Notification System	ERNS	04/2006	0.25	0
Texas Voluntary Cleanup Program	TXVCP	12/2005	0.5	0
Innocent Owner/Operator Program	TXIOP	12/2005	0.5	0
Texas State Superfund	TXSSF	10/2005	1	0
TCEQ Solid Waste Facilities	TXLF	01/2005	1	0
Unauthorized and Unpermitted Landfill Sites	LFUN	04/2002	0.5	0
Leaking Underground Storage Tanks	TXLUST	02/2006	0.5	3
Texas Underground Storage Tanks	TXUST	02/2006	0.25	6
Texas Above Ground Storage Tanks	TXAST	02/2006	0.25	0
Texas Spills List	TXSPILL	09/2003	0.25	0
Brownfield	BRNFD	02/2006	0.5	0
Dry Cleaner	DR C	02/2006	0.5	0

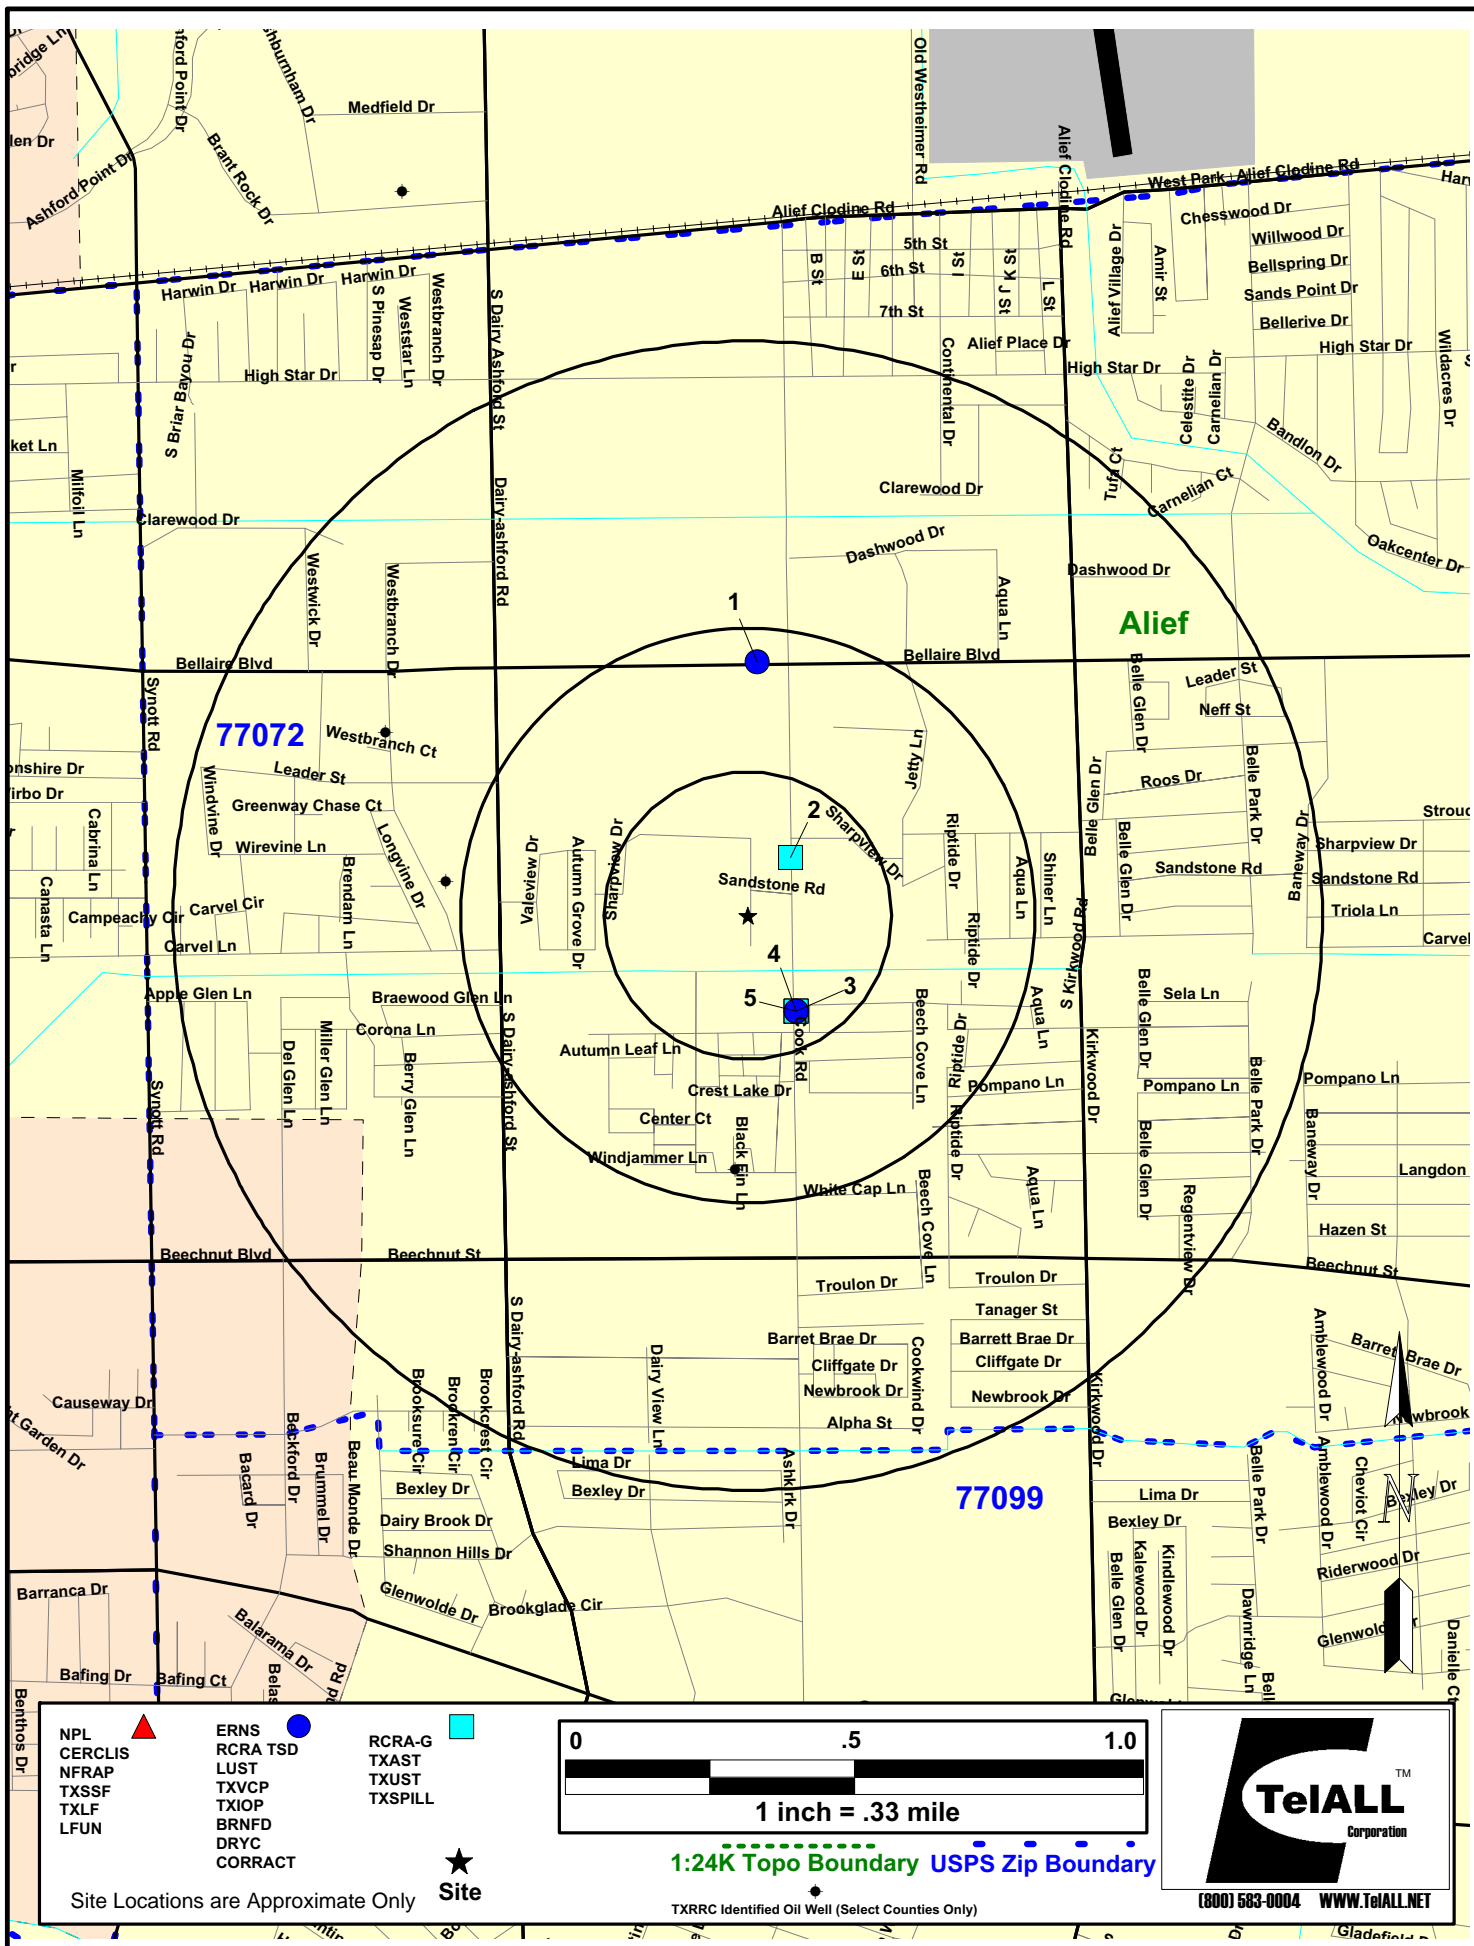





0 .125 .25




1 inch = 700 feet

1995 NAPP Photograph




(800) 583-0004 [WWW.TeiALL.NET](http://WWW.TeiALL.NET)



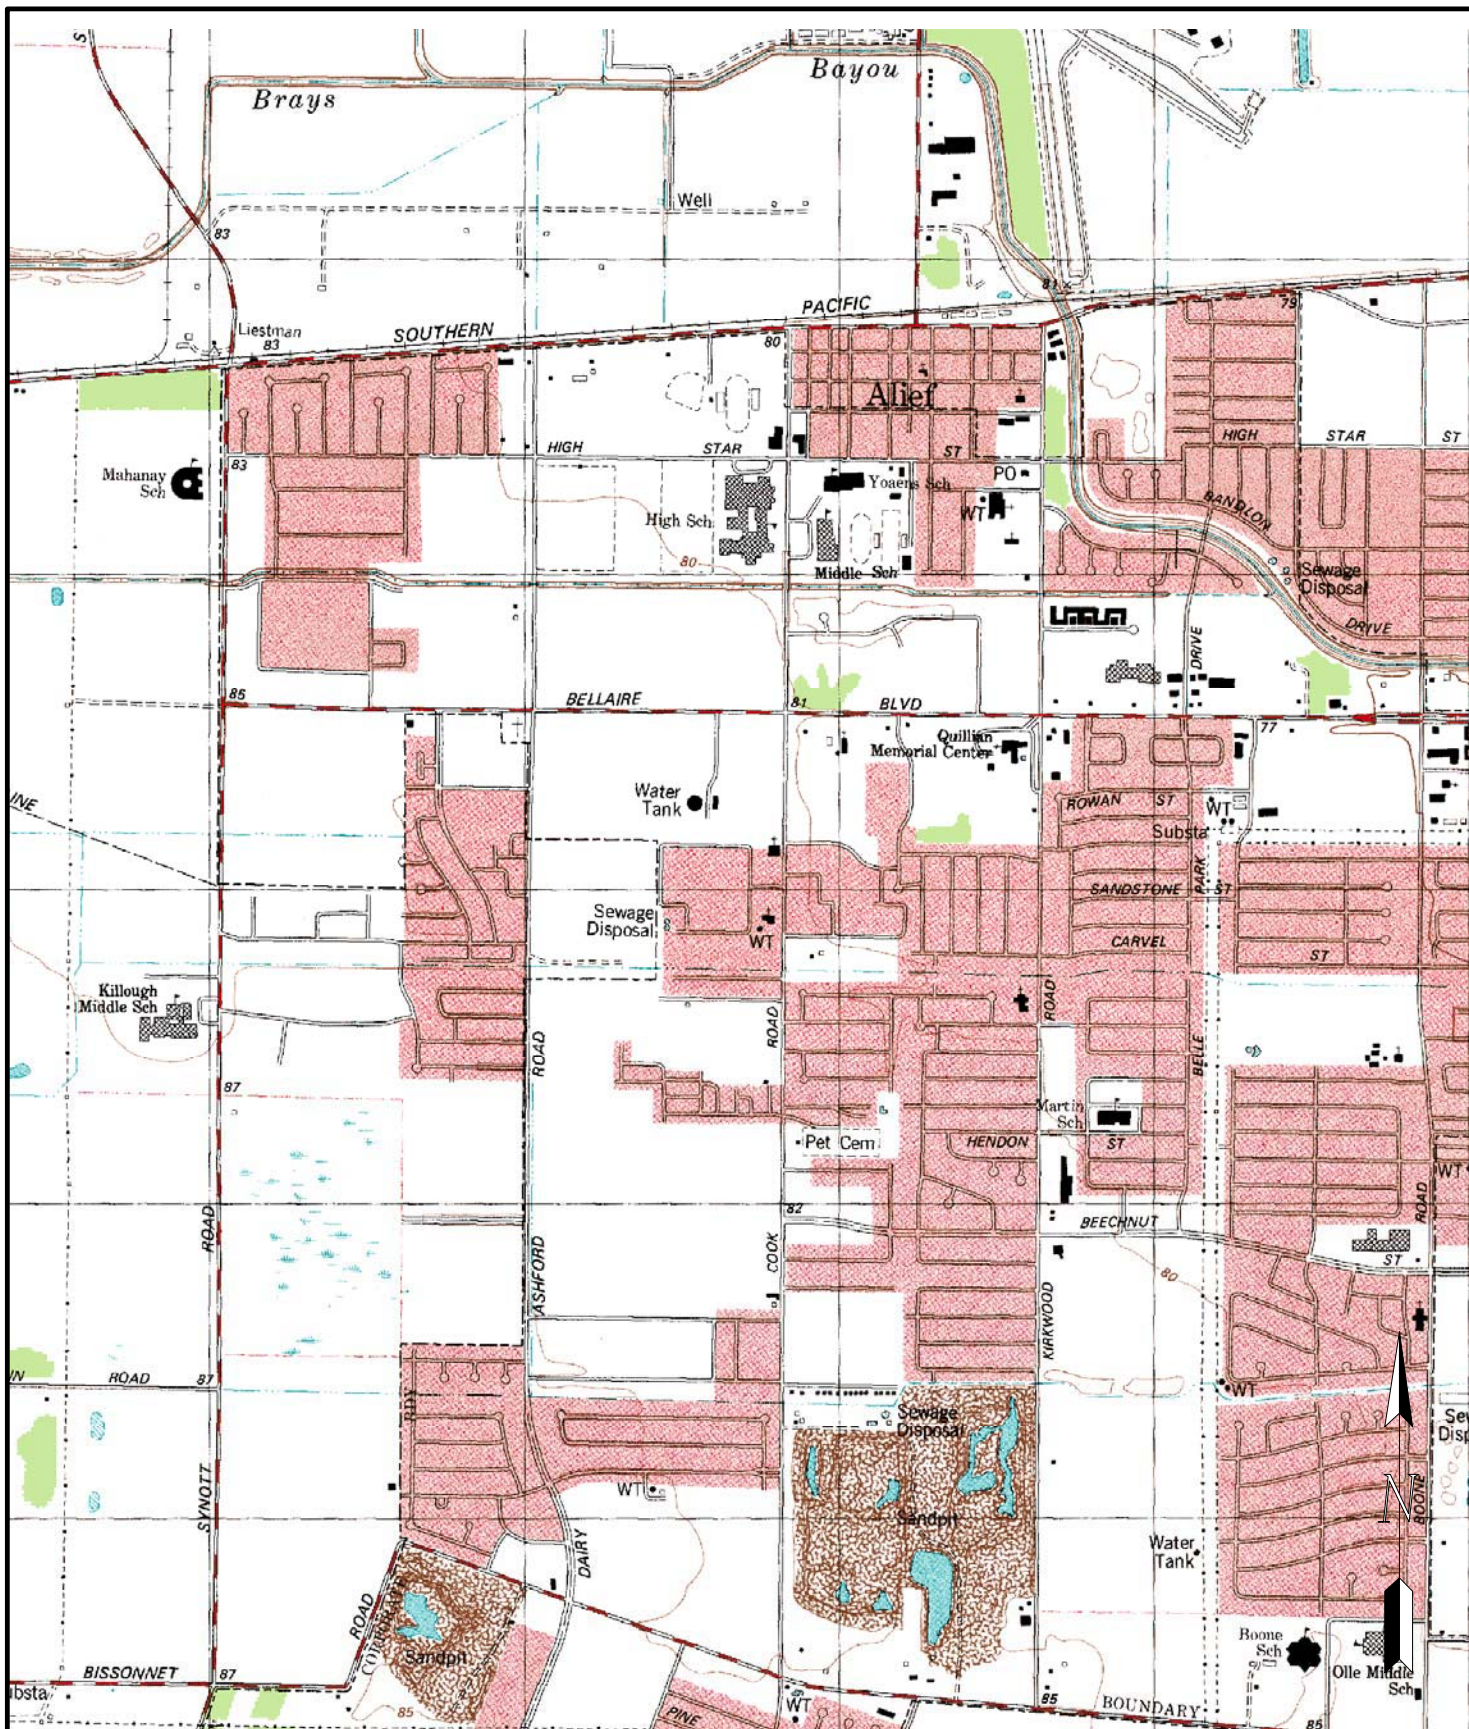

To identify the map area and orientation, the map is oriented to the north arrow. The map is oriented to the north arrow. The map is oriented to the north arrow.



(800) 583-0004 WWW.TEIALL.NET

**Current USGS 7.5 Minute Topographic Map**



**Sites Sorted By Distance from Center**

Distance/Direction	Database	Number	Address	City/State	Site Name
	DRYC				NO FINDINGS WITHIN 1/2 MILE.
	NPL				NO FINDINGS WITHIN ONE MILE.
	CERCLIS				NO FINDINGS WITHIN 1/2 MILE.
	ERNS				NO FINDINGS WITHIN 1/4 MILE.
	TXVCP				NO FINDINGS WITHIN 1/2 MILE.
	NFRAP				NO FINDINGS WITHIN 1/2 MILE.
	CORRACT				NO FINDINGS WITHIN ONE MILE.
	RCRA TSD				NO FINDINGS WITHIN ONE MILE.
	BRNFD				NO FINDINGS WITHIN 1/2 MILE.
	TXAST				NO FINDINGS WITHIN 1/4 MILE.
	TXLF				NO FINDINGS WITHIN ONE MILE.
	TXSSF				NO FINDINGS WITHIN ONE MILE.
	TXSPILL				NO FINDINGS WITHIN 1/4 MILE.
	LFUN				NO FINDINGS WITHIN 1/2 MILE.
	TXIOP				NO FINDINGS WITHIN 1/2 MILE.
	RCRA-G				NO FINDINGS WITHIN 1/4 MILE.
.11					
	N E	TXUST	2 7130 COOK RD	HOUSTON	FIRE STATION 76
	N E	TXUST	2 7130 COOK RD	HOUSTON	FIRE STATION 76
	N E	TXUST	2 7130 COOK RD	HOUSTON	FIRE STATION 76
.17					
	S E	TXUST	3 7621 COOK RD	HOUSTON	STOP N GO 2502
	S E	TXUST	3 7621 COOK RD	HOUSTON	STOP N GO 2502
	S E	TXUST	3 7621 COOK RD	HOUSTON	STOP N GO 2502
	S E	TXLUST	4 7621 COOK RD	HOUSTON	DIAMOND SHAMROCK 2502
.17					
	S E	TXLUST	5 7621 COOK RD CORONA	HOUSTON	STOP N GO 3554
.38					
	N E	TXLUST	1 12330 BELLAIRE	HOUSTON	RELIANT ENERG ENTEX WEST DIS

---

**NPL****National Priority List**

NPL is a priority subset of the CERCLIS list. (See CERCLIS, below) The Cerclis list was created by the Comprehensive Environmental Response, Compensation and Liability Acts (CERCLA) need to track contaminated sites. CERCLA was enacted on 12/11/80, and

amended by the Superfund Amendments and Reauthorization Act of 1986. These acts established broad authority for the government to respond to problems posed by the release, or threat of release of hazardous substances, pollutants, or contaminants. CERCLA

also imposed liability on those responsible for releases and provided the authority for the government to undertake enforcement and abatement action against responsible parties.

*Source: United States Environmental Protection Agency (EPA)*

**Database:** NPL

**Site:** No findings within one mile.

**Dir./Distance (in Miles)**

**Map Number:**

**Address:**

**Zip Code:**

**City:**

---

**CERCLIS****Comprehensive Environmental Response, Compensation, and Liability Information System**

CERCLIS is the official repository for site and non-site specific Superfund data in support of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). It contains information on hazardous waste site assessment and remediation

from 1983 to the present. CERCLIS information is used to report official Superfund accomplishments to Congress and the public, assist EPA Regional and Headquarters managers in evaluating the status and progress of site cleanup actions, track Superfund

Comprehensive Accomplishments Plan (SCAP), and communicate planned activities and budgets.

*Source: United States Environmental Protection Agency (EPA)*

**Database:** CERCLIS

**Site:** No findings within 1/2 mile.

**Dir./Distance (in Miles)**

**Map Number:**

**Address:**

**Zip Code:**

**City:**

---

## **NFRAP**

### No Further Remedial Action Planned

NFRAP Sites indicate a CERCLIS site that was designated "No further remedial action planned" by the EPA February 1995.

*Source: United States Environmental Protection Agency (EPA)*

**Database:** NFRAP

**Site:** No findings within 1/2 mile.

**Dir./Distance (in Miles)**

**Map Number:**

**Address:**

**Zip Code:**

**City:**

---

## **RCRA TSD**

### Resource Conservation and Recovery Information System - Treatment Storage or Disposal

Resource Conservation and Recovery Information System (RCRIS) Under the Resource Conservation and Recovery Act (RCRA), generators, transporters, treaters, storers, and disposers of hazardous waste as defined by the federally recognized hazardous waste are required to provide information concerning their activities to state environmental agencies, who in turn provide the information to regional and national U.S. EPA offices. The RCRA TSD (Treatment Storage or Disposal) is a subset of the RCRIS list.

RCRA TSD tracks facilities that fall under the Treatment Storage or Disposal classification.

*Source: United States Environmental Protection Agency (EPA)*

**Database:** RCRA TSD

**Site:** No findings within one mile.

**Dir./Distance (in Miles)**

**Map Number:**

**Address:**

**Zip Code:**

**City:**

---

## **CORRACT**

### Corrective Action

CORRACT lists RCRIS (Resource Conservation and Recovery Information System) sites that are currently under corrective action.

*Source: United States Environmental Protection Agency (EPA)*

**Database:** CORRACT

**Site:** No findings within one mile.

**Dir./Distance (in Miles)**

**Map Number:**

**Address:**

**Zip Code:**

**City:**

---

## **RCRA-G**

### Resource Conservation and Recovery Information System - Generators

Resource Conservation and Recovery Information System (RCRIS) Under the Resource Conservation and Recovery Act (RCRA), generators, transporters, treaters, storers, and disposers of hazardous waste as defined by the federally recognized hazardous waste, are required to provide information concerning their activities to state environmental agencies, who in turn provide the information to regional and national U.S. EPA offices. The RCRA-G (Generators) list is a subset of the RCRIS list.

RCRA-G tracks facilities that fall under the generators or transporters classification.

*CONDITIONALLY EXEMPT SMALL QUANTITY GENERATORS (CESQG) produce less than 100 kg per month of hazardous waste.*

*SMALL QUANTITY GENERATORS (SQG) produce at least 100 kg per month but less than 1000 kg per month of hazardous waste.*

*LARGE QUANTITY GENERATORS (LQG) produce at least 1000 kg per month of hazardous waste. Source: United States Environmental Protection Agency (EPA)*

**Database:** RCRA-G

**Site:** No findings within 1/4 mile.

**Dir./Distance (in Miles)**

**Map Number:**

**Address:**

**Zip Code:**

**City:**

---

**ERNS**Emergency Response Notification System

ERNS supports the release notification requirements of section 103 of the Comprehensive Environmental Response Compensation, and Liability Act (CERCLA), as amended; section 311 of the Clean Water Act; and sections 300.51 and 300.65 of the National Oil and Hazardous Substances Contingency Plan.

Additionally, ERNS serves as a mechanism to document and verify incident-location information as initially reported, and is utilized as a direct source of easily accessible data, needed for analyzing oil and hazardous substances spills.

*Source: National Response Center (NRC)*

**Database:** ERNS

**Site:** No findings within 1/4 mile.

**Dir./Distance (in Miles)**

**Map Number:**

**Address:**

**Zip Code:**

**City:**

---

**TXVCP**Texas Voluntary Cleanup Program

Created under HB 2296, The Texas Voluntary Cleanup Program (VCP) was established on 9/01/1995 to provide administrative, technical, and legal incentives to encourage the cleanup of contaminated sites in Texas. Since future lenders and landowners receive

protection from liability to the State of Texas for cleanup of sites under the VCP, most of the constraints for completing real estate transactions at those sites are eliminated. As a result, many unused or under used properties may be restored to economically productive or community beneficial uses. After cleanup, the parties receive a certificate of completion from the TCEQ which states that all lenders and future land owners who are not PRP's are released from all liability to the State.

*Parts of the above description were taken from the TCEQ/VCP Website. (<http://www.TCEQ.state.tx.us/permitting/remed/vcp/>)*

*The investigation phases are listed as INVESTIGATION, REMEDIATION, POST-CLOSURE, and COMPLETE.*

*Contaminant Categories (PERC and BTEX). Source: Texas Commission on Environmental Quality (TCEQ)*

**Database:** TXVCP

**Site:** No findings within 1/2 mile.

**Dir./Distance (in Miles)**

**Map Number:**

**Address:**

**Zip Code:**

**City:**

---

**TXIOP****Innocent Owner/Operator Program**

The TX IOP, created by House Bill 2776 of the 75th Leg, provides a cert. to an innocent owner or operator if their property is contaminated as a result of a release or migration of contaminants from a source or sources not loc. on the prop., and they

did not cause or contribute to the source or sources of contamination. Like the TxVCP Prog., the IOP can be used as a redevelopment tool or as a tool to add value to a contaminated prop. by providing an Innocent Owner/Operator Certificate (IOC). However,

unlike the VCP release of liability, IOCs are not trans. to future owners/oper's. Future owners/oper's are eligible to enter the IOP and may rec. an IOC only after they become an owner or operator of the site.

*The above description were taken from the TCEQ/IOP Website.  
(<http://www.TCEQ.state.tx.us/permitting/remed/vcp/iop.html>)*

*Source: Texas Commission on Environmental Quality (TCEQ)*

**Database:** TXIOP

**Site:** No findings within 1/2 mile.

**Dir./Distance (in Miles)**

**Map Number:**

**Address:**

**Zip Code:**

**City:**

---

**TXSSF****Texas State Superfund**

The Texas State Superfund database is a list of sites that the State of Texas has identified for investigation or remediation.

Texas State Superfund sites are reviewed for potential upgrading to Comprehensive Environmental Response, Compensation, and Liability Information System status by the federal Environmental Protection Agency.

*Source: Texas Commission on Environmental Quality (TCEQ)*

**Database:** TXSSF

**Site:** No findings within one mile.

**Dir./Distance (in Miles)**

**Map Number:**

**Address:**

**Zip Code:**

**City:**

---

## **TXLF**

### TCEQ Solid Waste Facilities

Texas Commission on Environmental Quality (TCEQ) Requires municipalities and counties to report known active and inactive landfills.

Texas Landfills is a listing of solid waste facilities registered and tracked by the TCEQ Solid waste division. The facilities tracked include solid waste disposal sites as well as transfer stations and processing stations.

*Source: Texas Commission on Environmental Quality (TCEQ)*

**Database:** TXLF

**Site:** No findings within one mile.

**Dir./Distance (in Miles)**

**Map Number:**

**Address:**

**Zip Code:**

**City:**

---

## **LFUN**

### Unauthorized and Unpermitted Landfill Sites

Unauthorized sites have no permit and are considered abandoned. All information about these sites was compiled by Southwest Texas State University under contract with TCEQ and is based on a search of publicly available records.

*Source: Texas Commission on Environmental Quality (TCEQ)*

**Database:** LFUN

**Site:** No findings within 1/2 mile.

**Dir./Distance (in Miles)**

**Map Number:**

**Address:**

**Zip Code:**

**City:**

## TXLUST

### Leaking Underground Storage Tanks

State lists of leaking underground storage tank sites. Section 9003(h) of Subtitle I of RCRA gives EPA and states, under cooperative agreements with EPA, authority to clean up releases from UST systems or require owners and operators to do so.

*Source: Texas Commission on Environmental Quality (TCEQ)*

**Database:** TXLUST  
**Site:** DIAMOND SHAMROCK 2502  
**Dir./Distance (in Miles)** S E .17  
**Map Number:** 4  
**Address:** 7621 COOK RD  
**Zip Code:** 77072  
**City:** HOUSTON

LEAKING PETROLEUM STORAGE TANK IDENTIFICATION NUMBER (LPSTID) 113016. THE SUBJECT TANK RELEASE WAS REPORTED ON 3/9/1998  
PRIORITY: 6 - MINOR SOIL CONTAMINATION-NO REMEDIAL ACTION REQUIRED.  
STATUS: 6A - FINAL CONCURRENCE ISSUED, CASE CLOSED.  
FAC ID NUMBER 0035337 PRP INFO: DIAMOND SHAMROCK, 4840 DACOMA, HOUSTON TX 77092 CONTACT: LOUIS MOSCONI TEL. 713/263-7377  
LOCATION DESCRIPTION: 7621 COOK RD

**Database:** T L ST  
**Site:** STO O  
**Dir./Distance (in Miles)** S  
**Map Number:** 5  
**Address:** OO O O A  
**Zip Code:**  
**City:** O STO

LEAKING PETROLEUM STORAGE TANK IDENTIFICATION NUMBER (LPSTID) 92199. THE SUBJECT TANK RELEASE WAS REPORTED ON 10/7/1988  
PRIORITY: 4.1 - GW IMPACTED, NO APPARENT THREATS OR IMPACTS TO RECEPTORS.  
STATUS: 6A - FINAL CONCURRENCE ISSUED, CASE CLOSED.  
FAC ID NUMBER 0035337 PRP INFO: NATIONAL CONVENIENCE STORES, PO BOX 758, HOUSTON TX 77001 CONTACT: JOHN WILLRODT TEL. 713/863-2318  
LOCATION DESCRIPTION: 7621 COOK RD @ CORONA

**Database:** T L ST  
**Site:** L A T T ST ST  
**Dir./Distance (in Miles)**  
**Map Number:** 1  
**Address:** LLA  
**Zip Code:**  
**City:** O STO

LEAKING PETROLEUM STORAGE TANK IDENTIFICATION NUMBER (LPSTID) 107463. THE SUBJECT TANK RELEASE WAS REPORTED ON 12/13/1993  
PRIORITY: 4.1 - GW IMPACTED, NO APPARENT THREATS OR IMPACTS TO RECEPTORS.  
STATUS: 6A - FINAL CONCURRENCE ISSUED, CASE CLOSED.  
FAC ID NUMBER 0000925 PRP INFO: ENTEX INC, 4615 NAVIGATION, HOUSTON TX 77011 CONTACT: GEORGE JOHN TEL. 713/654-5100  
LOCATION DESCRIPTION: 12330 BELLAIRE



ase SA ity ater arcels  
loc ro n est ri e o ston T

a e  
o  
ate

## TXUST

### Texas n er ro n Stora e Tan s

n er ro n Stora e Tan s ermitte n er ro n stora e tan s trac e an  
maintaine y t e Texas ommission on n ironmental ality T

Source: Texas Commission on Environmental Quality (TCEQ)

Database: T ST

Site: STAT O

Dir./Distance (in Miles)

Map Number: 2

Address: OO

Zip Code:

City: O STO

FACILITY ID NUMBER 0033445, TCEQ UNIT ID NUMBER 00172389, TANK ID NUMBER 2,DATE  
INSTALLED (MMDDYYYY) 02011994, TOTAL CAPACITY IN GALLONS: 0001000  
TANK IS CURRENTLY IN USE. TANK COMPARTMENTS: COMPARTMENT A: DIESEL. CAPACITY  
0001000 GAL  
THE TANK CONSTRUCTION IS OF FIBERGLASS-REINFORCED PLASTIC (FRP) - DOUBLE WALL.  
THE OWNER OF THE FACILITY IS CITY OF HOUSTON, THE TELEPHONE NUMBER LISTED FOR  
THE OWNER IS 713-247-2564.

FACILITY ID NUMBER 0033445, TCEQ UNIT ID NUMBER 00088450, TANK ID NUMBER 2,DATE  
INSTALLED (MMDDYYYY) 01011985, TOTAL CAPACITY IN GALLONS: 0001000  
TANK IS CURRENTLY REMOVED FROM GROUND. TANK COMPARTMENTS: COMPARTMENT A:  
DIESEL. CAPACITY 0001000 GAL  
THE TANK CONSTRUCTION IS OF FIBERGLASS-REINFORCED PLASTIC (FRP).  
THE OWNER OF THE FACILITY IS CITY OF HOUSTON, THE TELEPHONE NUMBER LISTED FOR  
THE OWNER IS 713-247-2564.

FACILITY ID NUMBER 0033445, TCEQ UNIT ID NUMBER 00088451, TANK ID NUMBER 1,DATE  
INSTALLED (MMDDYYYY) 01011985, TOTAL CAPACITY IN GALLONS: 0001000  
TANK IS CURRENTLY IN USE. TANK COMPARTMENTS: COMPARTMENT A: GASOLINE.  
CAPACITY 0001000 GAL  
THE TANK CONSTRUCTION IS OF FIBERGLASS-REINFORCED PLASTIC (FRP) - SINGLE WALL.  
THE OWNER OF THE FACILITY IS CITY OF HOUSTON, THE TELEPHONE NUMBER LISTED FOR  
THE OWNER IS 713-247-2564.

Database: T ST

Site: STO O

Dir./Distance (in Miles) S

Map Number: 3

Address: OO

Zip Code:

City: O STO

FACILITY ID NUMBER 0035337, TCEQ UNIT ID NUMBER 00093498, TANK ID NUMBER 3,DATE  
INSTALLED (MMDDYYYY) 01011972, TOTAL CAPACITY IN GALLONS: 0006000  
TANK IS CURRENTLY REMOVED FROM GROUND. TANK COMPARTMENTS: COMPARTMENT A:  
GASOLINE. CAPACITY 0006000 GAL  
THE TANK CONSTRUCTION IS OF STEEL.  
THE OWNER OF THE FACILITY IS DIAMOND SHAMROCK REFINING AND MARKETING  
COMPANY, THE TELEPHONE NUMBER LISTED FOR THE OWNER IS 210-345-4235.

FACILITY ID NUMBER 0035337, TCEQ UNIT ID NUMBER 00093499, TANK ID NUMBER 2, DATE  
INSTALLED (MMDDYYYY) 01011972, TOTAL CAPACITY IN GALLONS: 0006000  
TANK IS CURRENTLY REMOVED FROM GROUND. TANK COMPARTMENTS: COMPARTMENT A:  
GASOLINE. CAPACITY 0006000 GAL  
THE TANK CONSTRUCTION IS OF STEEL.  
THE OWNER OF THE FACILITY IS DIAMOND SHAMROCK REFINING AND MARKETING  
COMPANY, THE TELEPHONE NUMBER LISTED FOR THE OWNER IS 210-345-4235.

FACILITY ID NUMBER 0035337, TCEQ UNIT ID NUMBER 00093500, TANK ID NUMBER 1, DATE  
INSTALLED (MMDDYYYY) 01011978, TOTAL CAPACITY IN GALLONS: 0010000  
TANK IS CURRENTLY REMOVED FROM GROUND. TANK COMPARTMENTS: COMPARTMENT A:  
GASOLINE. CAPACITY 0010000 GAL  
THE TANK CONSTRUCTION IS OF STEEL.  
THE OWNER OF THE FACILITY IS DIAMOND SHAMROCK REFINING AND MARKETING  
COMPANY, THE TELEPHONE NUMBER LISTED FOR THE OWNER IS 210-345-4235.

## TXAST

### Texas A o e ro n Stora e Tan s

A o e ro n Stora e Tan s ermitte a o e ro n stora e tan s trac e an  
maintaine y t e Texas ommission on n ironmental ality T

*Source: Texas Commission on Environmental Quality (TCEQ)*

**Database:** T AST

**Site:** o in in s it in mile

**Dir./Distance (in Miles)**

**Map Number:**

**Address:**

**Zip Code:**

**City:**

## TXSPILL

### Texas Spills List

Texas ommission on n ironmental ality T trac s cases ere  
emer ency response is nee e or clean p o toxic s stances

*Source: Texas Commission on Environmental Quality (TCEQ)*

**Database:** T S LL

**Site:** o in in s it in mile

**Dir./Distance (in Miles)**

**Map Number:**

**Address:**

**Zip Code:**

**City:**

## BRNFD

### ro n iel

ro n iel s are real property t e expansion re e elopment or re se o ic  
may e complicate y t e presence or potential presence o a a ar o s  
s stance poll tant or contaminant

*Source: Texas Commission on Environmental Quality (TCEQ)*

**Database:**

**Site:** o in in s it in mile

**Dir./Distance (in Miles)**

**Map Number:**

**Address:**

**Zip Code:**

**City:**

## DRYC

### ry leaner

o se ill re ires all ry cleanin rop stations an acilities in Texas to  
re ister it Texas ommission on n ironmental ality T an implement  
ne per ormance stan ar s at t eir acilities as appropriate

t also re ires istri tors o ry cleanin sol ents to collect ees on t e sale o  
ry cleanin sol ents at certain acilities

*Source: Texas Commission on Environmental Quality (TCEQ)*

**Database:**

**Site:** o in in s it in mile

**Dir./Distance (in Miles)**

**Map Number:**

**Address:**

**Zip Code:**

**City:**

# APPENDIX H

## GOVERNMENT DATA & FILE REVIEW

# TelALL Zip Index

The following zip codes, are the zip codes that TelALL used for generating the preceding report. The information is provided to help our customers make the most thorough data evaluation possible.

Lat/Lon. info is provided to assist in locating sites. Lat/Lon info that is listed as "0" indicates that the site has not been geocoded. This does not indicate that the site is an orphan or was not evaluated by TelALL's research personnel.



FACZIP	DATABASE	SITENAME	ADD	CITY	LATITUDE	LONGITUDE
77072	DRYC	T P CLEANERS	7609 BOONE RD	HOUSTON	29.696171	-95.575437
		TIP TOP	4034 BOONE RD	HOUSTON	29.716135	-95.575868
		TRAN LOC BA	11911 BEECHNUT ST	HOUSTON	29.688689	-95.587789
	ERNS		2401 GALVESTON ROAD	HOUSTON		
			11342 BANDLON DRIVE	HOUSTON	29.708385	-95.579118
		11342 BANDLON DRIVE	HOUSTON	29.708385	-95.579118	
		BEAUMONT BULK TERMINAL	END OF BURT ST TIED UP AT FACILI	BEAUMONT	30.077435	-94.104147
		KIRB INLAND MARINE		HOUSTON		
RCRA-G		ACTIVE ENTERPRISES LLC	11311 BISSONNET	HOUSTON	29.67449	-95.577301
		ALIEF ISD MAINTENANCE CENTE	12135 HIGH STAR	HOUSTON	29.772575	-95.396041
		ALIEF ISD PRINTING SVC DEPT	12101 7TH ST	HOUSTON	29.712466	-95.591792
		EXXON CO USA NO 60445	10010 BEECHNUT STREET	HOUSTON	29.689982	-95.556815
		EXXON CO USA NO 60507	10004 BALLAIRE BLVD	HOUSTON	29.704724	-95.55745
		HOME DEPOT USA INC	6800 W SAM HOUSTON PKW S	HOUSTON	29.7065	-95.5568
		M-I LLC	5950 N COURSE DR	HOUSTON	29.715221	-95.563497
		QUEST DIAGNOSTICS	5850 ROGERDALE RD	HOUSTON	29.7186	-95.5595
		TEXACO STATION	10902 BELAIRE RD	HOUSTON	29.703985	-95.571526
			8053 S KIRKWOOD ST	HOUSTON	29.691	-95.5875
		U-HAUL INTERNATIONAL	11334 BELLAIRE BLVD	HOUSTON	29.703985	-95.577876
		WAL MART NEIGHBORHOOD MAR	11755 BEECHNUT STREET	HOUSTON	29.688675	-95.585592
TXAST		DISTRICT 184	10518 BEECHNUT	HOUSTON	29.689958	-95.557531
TXLF		CUSTOM DIRT WORKS	3000 FT WEST OF INT OF O'BRIEN &	HOUSTON		
TXLUST		ALIEF MOBIL STATION 12 BMG	11831 BELLAIRE BLVD KIRKWO	HOUSTON	29.666368	-95.313196
		BROWN & ROOT	10200 BELLARIRE	HOUSTON	29.704492	-95.560391
		CHEVRON	10901 BELLAIRE BLVD WILCREST	HOUSTON	29.666368	-95.313196
		CHEVRON 151612	BISSONNET & WILCREST	HOUSTON	29.67413	-95.57012
		CHEVRON 60200057	10005 BEECHNUT ST	HOUSTON	29.689872	-95.556828
		CHEVRON FAC 200629	191 E N SAM HOUSTON PKW	GR HOUSTON	29.941821	-95.409138
		DIAMOND SHAMROCK 2502	7621 COOK RD	HOUSTON	29.69499	-95.595907
		EXXON 6 0477	13200 BELLAIRE BLVD	HOUSTON	29.703591	-95.614895
		EXXON 60035	6060 WILCREST HARWIN	HOUSTON	29.716237	-95.571662
		EXXON 60082	10900 BEECHNUT	HOUSTON	29.688377	-95.570303
		FORMER UST	11501 BELLAIRE BLVD	HOUSTON	29.703872	-95.580697
		PHILLIPS 66 26272	11139 BELLAIRE BLVD	HOUSTON	29.703875	-95.574727
			11139 BELLAIRE BOULEVARD	HOUSTON	29.703875	-95.574727
		RELIANT ENERG ENTEX WEST	12330 BELLAIRE	HOUSTON	29.703774	-95.597039
		SHELL	11831 BELLAIRE BLVD	HOUSTON	29.703775	-95.586516
		SHELL STATION	10839 BELLAIRE BLVD	HOUSTON	29.703902	-95.570378
		SIGMOR 918	BEECHNUT	HOUSTON	29.688771	-95.605549
		STOP N GO 3554	7621 COOK RD CORONA	HOUSTON	29.69499	-95.595907
		STOP N GO MARKETS 1655	8303 WILCREST DR	HOUSTON	29.6864	-95.5698
		STOP N GO MARKETS 977	4040 BOONE RD HARWIN	HOUSTON	29.716095	-95.575868
		TEXACO	8053 S KIRKWOOD	HOUSTON	29.691	-95.5875
		TEXACO SERVICE STATION	10902 BELLAIRE BLVD	HOUSTON	29.703985	-95.571526
			11202 BEECHNUT ST BOONE RD	HOUSTON	29.755868	-95.530675
		WESTERN AUTO	BELLAIRE BLVD	HOUSTON	29.70628	-95.418401
TXSPILL		Air Prod/GSF Energy	Air Stripper	houston		
		Air Products	AIR STRIPPER TOWER T302	HOUSTON		
			AIR STRIPPER,AIR PRODUCTS,9416	Houston	29.8318	-95.2487
			FF80 BELT, LE ROAD	Houston		
			LE RD, HOUSTON	Houston	29.831175	-95.301831
			LE ROAD, HOUSTON	Houston	29.831175	-95.301831
			Plant wide	Houston		
		Air Products/GSF Energy	Air Products/GSF Energy, 9416 Ley Rd	Houston		
			Air Products/GSF Energy, 9416 Ley Rd	Houston		
			Air Products/GSF Energy, 9416 Ley Rd	Houston		
			Air Products/GSF Energy, 9416 Ley Rd	Houston		
			Air Products/GSF Energy, 9416 Ley Rd	Houston		
			Air Products/GSF Energy, 9416 Ley Rd	Houston		
			Air Products/GSF Energy, 9416 Ley Rd	Houston		
			Air Products/GSF Energy, 9416 Ley Rd	Houston		
			Air Products/GSF Energy, 9416 Ley Rd	Houston		
			BJF LANDFILL	Houston		
			CARBON BED CHANGE OUT	Houston		
			LE RD., HOUSTON	Houston	29.831175	-95.301831
			LE ROAD.,Air Products/GSF Energy,	Houston	29.831175	-95.301831
		pipe maint.	Houston			
		Plant	Houston			
		AIR PRODUCTS/GSF ENERG INC	LA RD	HOUSTON		
		Air Products-LaPorte	LE ROAD, HOUSTON	Houston	29.831175	-95.301831
		Enterprise Products	V302 analyzer	Houston		
		PHIBRO	PHIBRO. 9701 MANCHESTER. HOUS	HOUSTON		

FACZIP	DATABASE	SITENAME	ADD	CITY	LATITUDE	LONGITUDE
77072	TXUST	88 FOOD STORE	11140 BELLAIRE BLVD	HOUSTON	29.703985	-95.574754
			11140 BELLAIRE BLVD	HOUSTON	29.703985	-95.574754
		ALIEF CAR CARE CENTER	11150 BEECHNUT ST	HOUSTON	29.688054	-95.573862
		ALIEF ISD LEARNING CENTER	4427 BELLE PARK DR	HOUSTON	29.708805	-95.582904
		AMA HOLDINGS	11101 BELLAIRE Blvd	HOUSTON	29.703875	-95.574212
		ANTHON C COLBERT	11302 BELLAIRE BLVD	HOUSTON	29.703985	-95.577356
			11302 BELLAIRE BLVD	HOUSTON	29.703985	-95.577356
			11302 BELLAIRE BLVD	HOUSTON	29.703985	-95.577356
		ASTRO CAR CARE CENTER INC	12127 BELLAIRE	HOUSTON	29.703675	-95.593225
		BEECHNUT ON THE RUN 60445	10010 BEECHNUT	HOUSTON	29.689982	-95.556815
			10010 BEECHNUT	HOUSTON	29.689982	-95.556815
			10010 BEECHNUT	HOUSTON	29.689982	-95.556815
		BOONE ROAD SHOPPING CENTE	8002 BOONE RD	HOUSTON	29.691769	-95.574668
			8002 BOONE RD	HOUSTON	29.691769	-95.574668
		BROWN & ROOT INC	10200 BELLAIRE	HOUSTON	29.704492	-95.560391
			10200 BELLAIRE	HOUSTON	29.704492	-95.560391
			10200 BELLAIRE	HOUSTON	29.704492	-95.560391
			10200 BELLAIRE	HOUSTON	29.704492	-95.560391
		CENTERPOINT ENERG ENTEX	12330 BELLAIRE BLVD	HOUSTON	29.703774	-95.597039
			12330 BELLAIRE BLVD	HOUSTON	29.703774	-95.597039
			12330 BELLAIRE BLVD	HOUSTON	29.703774	-95.597039
		CHEVRON	10901 BELLAIRE	HOUSTON	29.703875	-95.571499
			10901 BELLAIRE	HOUSTON	29.703875	-95.571499
			10901 BELLAIRE	HOUSTON	29.703875	-95.571499
			10901 BELLAIRE	HOUSTON	29.703875	-95.571499
		CHEVRON 1	10005 BEECHNUT St	HOUSTON	29.689872	-95.556828
			10005 BEECHNUT St	HOUSTON	29.689872	-95.556828
			10005 BEECHNUT St	HOUSTON	29.689872	-95.556828
		CHEVRON FAC 166605	11900 BELLAIRE	HOUSTON	29.703884	-95.588
			11900 BELLAIRE	HOUSTON	29.703884	-95.588
			11900 BELLAIRE	HOUSTON	29.703884	-95.588
			11900 BELLAIRE	HOUSTON	29.703884	-95.588
		CIRCLE K 2148	11203 BEECHNUT	HOUSTON	29.687875	-95.574773
			11203 BEECHNUT	HOUSTON	29.687875	-95.574773
		CIRCLE K 2158	11903 BEECHNUT	HOUSTON	29.688681	-95.587639
			11903 BEECHNUT	HOUSTON	29.688681	-95.587639
		CIRCLE P FOOD STORE	12099 BELLAIRE	HOUSTON	29.703677	-95.59264
			12099 BELLAIRE	HOUSTON	29.703677	-95.59264
			12099 BELLAIRE	HOUSTON	29.703677	-95.59264
		CLARK STORE	12298 BEECHNUT ST	HOUSTON	29.688883	-95.59574
			12298 BEECHNUT ST	HOUSTON	29.688883	-95.59574
			12298 BEECHNUT ST	HOUSTON	29.688883	-95.59574
		COURTES CHEVRON 3	6707 W SAM HOUSTON PKW S	HOUSTON	29.7076	-95.5568
			6707 W SAM HOUSTON PKW S	HOUSTON	29.7076	-95.5568
			6707 W SAM HOUSTON PKW S	HOUSTON	29.7076	-95.5568
		CREST BELL STAR FUELS	10902 BELLAIRE	HOUSTON	29.703985	-95.571526
			10902 BELLAIRE	HOUSTON	29.703985	-95.571526
			10902 BELLAIRE	HOUSTON	29.703985	-95.571526
			10902 BELLAIRE	HOUSTON	29.703985	-95.571526
			10902 BELLAIRE	HOUSTON	29.703985	-95.571526
			10902 BELLAIRE	HOUSTON	29.703985	-95.571526
			10902 BELLAIRE	HOUSTON	29.703985	-95.571526
		DAN SICKLE 63960	11830 BELLAIRE	HOUSTON	29.703885	-95.586399
			11830 BELLAIRE	HOUSTON	29.703885	-95.586399
			11830 BELLAIRE	HOUSTON	29.703885	-95.586399
			11830 BELLAIRE	HOUSTON	29.703885	-95.586399
		DELTA FOOD STORE	12313 BELLAIRE	HOUSTON	29.70367	-95.596534
			12313 BELLAIRE	HOUSTON	29.70367	-95.596534
			12313 BELLAIRE	HOUSTON	29.70367	-95.596534
		DIAMOND SHAMROCK 918	11190 BEECHNUT	HOUSTON	29.688002	-95.574432
			11190 BEECHNUT	HOUSTON	29.688002	-95.574432
			11190 BEECHNUT	HOUSTON	29.688002	-95.574432
			11190 BEECHNUT	HOUSTON	29.688002	-95.574432
		EXXON 60477	13200 BELLAIRE BLVD	HOUSTON	29.703591	-95.614895
			13200 BELLAIRE BLVD	HOUSTON	29.703591	-95.614895
			13200 BELLAIRE BLVD	HOUSTON	29.703591	-95.614895
			13200 BELLAIRE BLVD	HOUSTON	29.703591	-95.614895
		EXXON RS 6 0035	6060 WILCREST	HOUSTON	29.716237	-95.571662
			6060 WILCREST	HOUSTON	29.716237	-95.571662
			6060 WILCREST	HOUSTON	29.716237	-95.571662
			6060 WILCREST	HOUSTON	29.716237	-95.571662
		EXXON RS 60507	10004 BELLAIRE BLVD	HOUSTON	29.704724	-95.55745
			10004 BELLAIRE BLVD	HOUSTON	29.704724	-95.55745
			10004 BELLAIRE BLVD	HOUSTON	29.704724	-95.55745
		FIRE STATION 73	9600 WILCREST	HOUSTON	29.674061	-95.570168
			9600 WILCREST	HOUSTON	29.674061	-95.570168
		FIRE STATION 76	7130 COOK RD	HOUSTON	29.698854	-95.596068

FACZIP	DATABASE	SITENAME	ADD	CITY	LATITUDE	LONGITUDE
77072	TXUST	FIRE STATION 76	7130 COOK RD	HOUSTON	29.698854	-95.596068
			7130 COOK RD	HOUSTON	29.698854	-95.596068
		HOBART ENTERPRISES INC	6811 JETT	HOUSTON	29.703646	-95.592742
			6811 JETT	HOUSTON	29.703646	-95.592742
		IMCO SERVICES	6909 WALLISVILLE RD	HOUSTON	29.787485	-95.300853
			6909 WALLISVILLE RD	HOUSTON	29.787485	-95.300853
			6909 WALLISVILLE RD	HOUSTON	29.787485	-95.300853
		KIRKWOOD TEXACO	7301 S KIRKWOOD	HOUSTON	29.699643	-95.587624
			7301 S KIRKWOOD	HOUSTON	29.699643	-95.587624
			7301 S KIRKWOOD	HOUSTON	29.699643	-95.587624
		KMART 3466 M & B FOOD STORE	12610 BELLAIRE BLVD	HOUSTON	29.703685	-95.604848
			12780 BELLAIRE BLVD	HOUSTON	29.703602	-95.607376
			12780 BELLAIRE BLVD	HOUSTON	29.703602	-95.607376
		MINS ALL SEASONS FOOD STOR	12780 BELLAIRE BLVD	HOUSTON	29.703602	-95.607376
			12297 BEECHNUT ST	HOUSTON	29.688772	-95.595709
			12297 BEECHNUT ST	HOUSTON	29.688772	-95.595709
		MR TRANSMISSION MURPH USA 6765	6821 S KIRKWOOD	HOUSTON	29.7032	-95.5878
			11725 BEECHNUT ST	HOUSTON	29.688675	-95.585207
			11725 BEECHNUT ST	HOUSTON	29.688675	-95.585207
		NU SOUTH WA MOTORS	7529 KIRKWOOD	HOUSTON	29.6953	-95.5876
			7529 KIRKWOOD	HOUSTON	29.6953	-95.5876
		ONE STOP AUTO CENTER PHILLIPS 66	12776 BELLAIRE Blvd	HOUSTON	29.703605	-95.607317
			11139 BELLAIRE BLVD	HOUSTON	29.703875	-95.574727
			11139 BELLAIRE BLVD	HOUSTON	29.703875	-95.574727
		PHILLIPS 66 FOOD MART	11139 BELLAIRE BLVD	HOUSTON	29.703875	-95.574727
			12306 BEECHNUT ST	HOUSTON	29.688886	-95.596023
			12306 BEECHNUT ST	HOUSTON	29.688886	-95.596023
		PHILLIPS FOOD STORE	12306 BEECHNUT ST	HOUSTON	29.688886	-95.596023
			7911 WILCREST DR	HOUSTON	29.691536	-95.570972
			7911 WILCREST DR	HOUSTON	29.691536	-95.570972
		PHUQU CENTER POP CORNER	12809 BELLAIRE BLVD	HOUSTON	29.703475	-95.607996
			12550 BELLAIRE BLVD	HOUSTON	29.703702	-95.603198
			12550 BELLAIRE BLVD	HOUSTON	29.703702	-95.603198
		SHELL	11398 HARWIN DR	HOUSTON	29.7159	-95.5696
			11398 HARWIN DR	HOUSTON	29.7159	-95.5696
			11398 HARWIN DR	HOUSTON	29.7159	-95.5696
			11398 HARWIN DR	HOUSTON	29.7159	-95.5696
			11831 BELLAIRE BLVD	HOUSTON	29.703775	-95.586516
			11831 BELLAIRE BLVD	HOUSTON	29.703775	-95.586516
			11831 BELLAIRE BLVD	HOUSTON	29.703775	-95.586516
			11831 BELLAIRE BLVD	HOUSTON	29.703775	-95.586516
			11831 BELLAIRE BLVD	HOUSTON	29.703775	-95.586516
			11831 BELLAIRE BLVD	HOUSTON	29.703775	-95.586516
			12261 BELLAIRE BLVD	HOUSTON	29.703675	-95.595419
			12261 BELLAIRE BLVD	HOUSTON	29.703675	-95.595419
			12261 BELLAIRE BLVD	HOUSTON	29.703675	-95.595419
			12261 BELLAIRE BLVD	HOUSTON	29.703675	-95.595419
			12261 BELLAIRE BLVD	HOUSTON	29.703675	-95.595419
		SHELL STATION	10839 BELLAIRE Blvd	HOUSTON	29.703902	-95.570378
			10839 BELLAIRE Blvd	HOUSTON	29.703902	-95.570378
			10839 BELLAIRE Blvd	HOUSTON	29.703902	-95.570378
			10839 BELLAIRE Blvd	HOUSTON	29.703902	-95.570378
			10839 BELLAIRE Blvd	HOUSTON	29.703902	-95.570378
			10839 BELLAIRE Blvd	HOUSTON	29.703902	-95.570378
		SOUTHWEST EXTERMINATING C SOUTHWESTERN BELL TELEPHO STAR FUELS BEECH BOONE	6823 S KIRKWOOD	HOUSTON	29.703764	-95.587869
			7103 BANEWA	HOUSTON	29.701641	-95.580472
			11202 BEECHNUT	HOUSTON	29.687985	-95.574773
			11202 BEECHNUT	HOUSTON	29.687985	-95.574773
		STOP N GO 2302	11202 BEECHNUT	HOUSTON	29.687985	-95.574773
			8303 WILCREST DR	HOUSTON	29.6864	-95.5698
			8303 WILCREST DR	HOUSTON	29.6864	-95.5698
			8303 WILCREST DR	HOUSTON	29.6864	-95.5698
		STOP N GO 2502	8303 WILCREST DR	HOUSTON	29.6864	-95.5698
			7621 COOK RD	HOUSTON	29.69499	-95.595907
			7621 COOK RD	HOUSTON	29.69499	-95.595907
		STOP N GO 3664	7621 COOK RD	HOUSTON	29.69499	-95.595907
			2303 S KIRKWOOD	HOUSTON	29.740836	-95.588659
			2303 S KIRKWOOD	HOUSTON	29.740836	-95.588659
		STOP N GO MARKETS 251	2303 S KIRKWOOD	HOUSTON	29.740836	-95.588659
			11503 BELLAIRE	HOUSTON	29.70387	-95.580747
		STOP N GO MARKETS 977	11503 BELLAIRE	HOUSTON	29.70387	-95.580747
			4040 BOONE RD	HOUSTON	29.716095	-95.575868
			4040 BOONE RD	HOUSTON	29.716095	-95.575868
		SUPREME CITGO	4040 BOONE RD	HOUSTON	29.716095	-95.575868
			10900 BEECHNUT	HOUSTON	29.688377	-95.570303
			10900 BEECHNUT	HOUSTON	29.688377	-95.570303
			10900 BEECHNUT	HOUSTON	29.688377	-95.570303
		TEXACO KIRKWOOD CENTER	10900 BEECHNUT	HOUSTON	29.688377	-95.570303
			8053 S KIRKWOOD	HOUSTON	29.691	-95.5875



FACZIP	DATABASE	SITENAME	ADD	CITY	LATITUDE	LONGITUDE
77072	TXUST	TEXACO KIRKWOOD CENTER	8053 S KIRKWOOD	HOUSTON	29.691	-95.5875
			8053 S KIRKWOOD	HOUSTON	29.691	-95.5875
			8053 S KIRKWOOD	HOUSTON	29.691	-95.5875
		TRUST MOTOR COMPAN	4211 COOK Rd	HOUSTON	29.712688	-95.596272
			4211 COOK Rd	HOUSTON	29.712688	-95.596272
			4211 COOK Rd	HOUSTON	29.712688	-95.596272
		U-HAUL 746-72	11344 BELLAIRE BLVD	HOUSTON	29.703985	-95.578039
			11344 BELLAIRE BLVD	HOUSTON	29.703985	-95.578039
			11344 BELLAIRE BLVD	HOUSTON	29.703985	-95.578039
			11344 BELLAIRE BLVD	HOUSTON	29.703985	-95.578039
			11344 BELLAIRE BLVD	HOUSTON	29.703985	-95.578039
			11703 BEECHNUT	HOUSTON	29.688675	-95.584925
		USPS BEECHNUT STATION	11703 BEECHNUT	HOUSTON	29.688675	-95.584925
		WESTERN AUTO	11698 BELLAIRE BLVD	HOUSTON	29.703885	-95.584564
		HL&P	12004 Bellaire Blvd	Houston	29.703826	-95.591166
		77072-231 TXSPILL	BEECHNUT CAR CARE	Houston	29.688592	-95.581194
		77072-410	HOUSTON LIGHT & POWER	Houston	29.689958	-95.557537
		77072-449		Houston	29.689958	-95.557537
		77072-501 TXUST	8181 W SAM HOUSTON PKW S	HOUSTON	29.692	-95.5568
			8181 W SAM HOUSTON PKW S	HOUSTON	29.692	-95.5568
		77099 DRYC	12651 BISSONNET ST	HOUSTON	29.677336	-95.600512
77099	DRYC	DR CLEANING FACILIT	10795 W BELLFORT ST	HOUSTON	29.653862	-95.568271
		PRO CLEANERS	11560 S WILCREST DR	HOUSTON	29.653418	-95.569219
		QUALIT CARE CLEANERS	10614 S KIRKWOOD RD	HOUSTON	29.6628	-95.5851
		T & T CLEANERS	11649 W BELLFORT ST	HOUSTON	29.656945	-95.58215
		ERNS	8800 WEST SAM HOUSTON PARKW	HOUSTON	29.6871	-95.5581
		NFRAP	12000 BISSONNET	HOUSTON	29.675335	-95.589036
			12701 BISSONNET	HOUSTON	29.677799	-95.602008
		RCRA-G	10525 KINGHURST	HOUSTON	29.660781	-95.562894
			10450 STANCLIFF ROAD NO 210	HOUSTON	29.657384	-95.563258
			10865 SEABOARD LOOP	HOUSTON	29.661285	-95.571518
			10627 KINGHURST DR	HOUSTON	29.661128	-95.564112
			10215 LANDSBUR	HOUSTON	29.660225	-95.574544
			12707 BISSONNET ST	HOUSTON	29.677858	-95.602207
			10650 STANCLIFF ROAD	HOUSTON	29.658086	-95.56562
			10502 FALLSTONE RD	HOUSTON	29.659409	-95.563201
			10625 FALLSTONE ROAD	HOUSTON	29.659628	-95.564376
		TXAST	9304 KIRKWOOD	HOUSTON	29.677283	-95.587317
			10202 S NOTT	ALIEF	29.670478	-95.616053
77099	TXLUST	SPRINT PCS - HOUSTON 2	10718 FALLSTONE	HOUSTON	29.659983	-95.565236
		ALBERTSONS EXPRESS 2755	9525 KIRKWOOD	HOUSTON	29.6745	-95.5873
		B & T DIRT WORKS INC	OLD RICHMOND RD	HOUSTON	29.679586	-95.60839
		BEST FOOD MARKET TEXACO	13102 BISSONNET	HOUSTON	29.680742	-95.612666
		CHEVRON 157993	12703 BISSONNET RD	DAIR ASH	29.677343	-95.643344
		DIAMOND SHAMROCK 2198	10555 WILCREST	HOUSTON	29.671712	-95.570072
		DIAMOND SHAMROCK STATION 9	BISSONNET	HOUSTON	29.67491	-95.581465
		EXXON 60579	BISSONNET AVE	HOUSTON	29.677343	-95.643344
		EXXON STATION 62022	BISSONNET	HOUSTON	29.67491	-95.581465
		FORMER GEMCO EQUIPMENT CO	12626 W BELLFORT	HOUSTON	29.660872	-95.604184
		FORMER MOBIL 12AG9	W BELLFORT KIRKWOOD	HOUSTON	29.6619	-95.6091
		HANDI PLUS 33	12790 S DAIR ASHFORD	HOUSTON	29.6621	-95.5979
		HANDI PLUS 57	12300 BISSONNET	HOUSTON	29.676005	-95.59568
		HOUSTON SHELL & CONCRETE	10202 S NOTT RD	ALIEF	29.670478	-95.616053
		MOBIL 12AJG	400 GRAPEVINE HW	COLLE VILLE	32.86692	-97.172261
		PRIME EQUIPMENT	11003 BISSONNET	HOUSTON	29.67412	-95.572139
		QUAKER STATE MINIT LUBE 118	1260 BISSONNET	HOUSTON	29.726185	-95.394253
77099	TXUST	SIGMOR SHAMROCK 710	10030 BISSONNET	HOUSTON	29.675	-95.554972
		TEXACO	BISSONNET	HOUSTON	29.67491	-95.581465
		TEXACO SERVICE STATION	11905 BISSONNET	HOUSTON	29.675179	-95.58737
		ALIEF CO	9304 KIRKWOOD	HOUSTON	29.677283	-95.587317
		ALLBRIGHT DETAILING FORMERL	11613 BISSONNET ST	HOUSTON	29.674944	-95.583551
		A-PLUS PAWN	11260 S WILCREST	HOUSTON	29.659429	-95.567333
		B & T DIRT WORK INC	12943 OLD RICHMOND RD	HOUSTON	29.678769	-95.608619
		BISSONNET MOBIL	12697 BISSONNET ST	HOUSTON	29.677737	-95.601804
			12697 BISSONNET ST	HOUSTON	29.677737	-95.601804
			12697 BISSONNET ST	HOUSTON	29.677737	-95.601804
			12697 BISSONNET ST	HOUSTON	29.677737	-95.601804
		BOONE RD PLANT	8602 WILCREST	HOUSTON	29.683568	-95.569825
		BROOKFIELD PLANT	9007 DAIR VIEW	HOUSTON	29.679939	-95.599535
		CIRCLE K 2249	10841 BISSONNET	HOUSTON	29.673994	-95.568897
			10841 BISSONNET	HOUSTON	29.673994	-95.568897
		DELTA FOOD STORE	9803 S KIRKWOOD RD	HOUSTON	29.671668	-95.587792
			9803 S KIRKWOOD RD	HOUSTON	29.671668	-95.587792
			9803 S KIRKWOOD RD	HOUSTON	29.671668	-95.587792
77099	EXXON 62022		10831 BISSONNET	HOUSTON	29.67398	-95.568699
			10831 BISSONNET	HOUSTON	29.67398	-95.568699
			10831 BISSONNET	HOUSTON	29.67398	-95.568699
			10831 BISSONNET	HOUSTON	29.67398	-95.568699

FACZIP	DATABASE	SITENAME	ADD	CITY	LATITUDE	LONGITUDE
77099	TXUST	FAST TRACK MART	10814 W BELLFORT AVE	HOUSTON	29.654006	-95.568399
			10814 W BELLFORT AVE	HOUSTON	29.654006	-95.568399
			10814 W BELLFORT AVE	HOUSTON	29.654006	-95.568399
		FASTER FUEL	12703 BISSONNET ST	HOUSTON	29.677819	-95.602074
			12703 BISSONNET ST	HOUSTON	29.677819	-95.602074
			12703 BISSONNET ST	HOUSTON	29.677819	-95.602074
			12703 BISSONNET ST	HOUSTON	29.677819	-95.602074
			12703 BISSONNET ST	HOUSTON	29.677819	-95.602074
			12703 BISSONNET ST	HOUSTON	29.677819	-95.602074
			12703 BISSONNET ST	HOUSTON	29.677819	-95.602074
		FIRESTONE STORE 4725 FUEL DEPOT	12601 BISSONNET	HOUSTON	29.676901	-95.599108
			11651 W BELLFORT ST	HOUSTON	29.65695	-95.582194
			11651 W BELLFORT ST	HOUSTON	29.65695	-95.582194
		GEMCO EQUIPMENT CO GIERHART VAUGHN CONSTRUCT	11651 W BELLFORT ST	HOUSTON	29.65695	-95.582194
			12626 W BELLFORT	HOUSTON	29.660872	-95.604184
			8703 MEADOWCROFT	HOUSTON	29.731175	-95.516463
		GREG BINGHAMS TEN MINUTE OI HANDI PLUS 33	11330 WILCREST	HOUSTON	29.659014	-95.567442
			12790 S DAIR ASHFORD	HOUSTON	29.661072	-95.597694
			12790 S DAIR ASHFORD	HOUSTON	29.661072	-95.597694
		HANDI PLUS 57	12300 BISSONNET	HOUSTON	29.676005	-95.59568
			12300 BISSONNET	HOUSTON	29.676005	-95.59568
			12300 BISSONNET	HOUSTON	29.676005	-95.59568
		HANDI STOP 60	11603 BISSONNET ST	HOUSTON	29.674939	-95.583442
			11603 BISSONNET ST	HOUSTON	29.674939	-95.583442
			11603 BISSONNET ST	HOUSTON	29.674939	-95.583442
		HANDI STOP 66	10555 S WILCREST DR	HOUSTON	29.671712	-95.570072
			10555 S WILCREST DR	HOUSTON	29.671712	-95.570072
			10555 S WILCREST DR	HOUSTON	29.671712	-95.570072
		HOUSTON SHELL & CONCRETE J & J AUTOMOTIVE INC	10202 S NOTT	ALIEF	29.670478	-95.616053
			9610 WILCREST	HOUSTON	29.674026	-95.570168
		KORNER FOOD MART 1	13150 BISSONNET	HOUSTON	29.680858	-95.613501
			13150 BISSONNET	HOUSTON	29.680858	-95.613501
			13150 BISSONNET	HOUSTON	29.680858	-95.613501
			13150 BISSONNET	HOUSTON	29.680858	-95.613501
			13150 BISSONNET	HOUSTON	29.680858	-95.613501
		KRISP S BAKER	12653 BISSONNET	HOUSTON	29.677354	-95.600568
		KROGER FUEL FACILIT 745	9525 S KIRKWOOD	HOUSTON	29.6745	-95.5873
			9525 S KIRKWOOD	HOUSTON	29.6745	-95.5873
		MARK PRODUCTS INC MA CO MUFFLER	10502 FALLSTONE	HOUSTON	29.659409	-95.563201
			11351 BISSONNET	HOUSTON	29.674542	-95.577961
		MURILLO ENGINEERING INC	10910 STANCLIFF	HOUSTON	29.659464	-95.570152
			10910 STANCLIFF	HOUSTON	29.659464	-95.570152
		MURPH USA 7237	8450 E SAM HOUSTON PKW S	HOUSTON	29.8527	-95.1865
			8450 E SAM HOUSTON PKW S	HOUSTON	29.8527	-95.1865
		NP FOOD	11249 BISSONNET	HOUSTON	29.674447	-95.57639
			11249 BISSONNET	HOUSTON	29.674447	-95.57639
			11249 BISSONNET	HOUSTON	29.674447	-95.57639
			11249 BISSONNET	HOUSTON	29.674447	-95.57639
		PRIME EQUIPMENT 101	11003 BISSONNET	HOUSTON	29.67412	-95.572139
		QUAKER STATE MINIT LUBE 1188 RACETRAC 573	12160 BISSONNET	HOUSTON	29.67569	-95.594511
			10445 BISSONNET St	HOUSTON	29.674474	-95.561395
			10445 BISSONNET St	HOUSTON	29.674474	-95.561395
			10445 BISSONNET St	HOUSTON	29.674474	-95.561395
		REAGAN C HELM SHELL	10610 W WILCREST	HOUSTON	29.664885	-95.568207
			10330 BISSONNET ST	HOUSTON	29.674671	-95.560127
			10330 BISSONNET ST	HOUSTON	29.674671	-95.560127
			11660 W BELLFORT	HOUSTON	29.657083	-95.582403
		SHOP N GO	11660 W BELLFORT	HOUSTON	29.657083	-95.582403
			11660 W BELLFORT	HOUSTON	29.657083	-95.582403
			11660 W BELLFORT	HOUSTON	29.657083	-95.582403
			11660 W BELLFORT	HOUSTON	29.657083	-95.582403
		SHORT TRIP FOOD MART	12222 BISSONNET	HOUSTON	29.675813	-95.59497
			12222 BISSONNET	HOUSTON	29.675813	-95.59497
			12222 BISSONNET	HOUSTON	29.675813	-95.59497
		SIGMOR SHAMROCK 710	8703 BOONE RD	HOUSTON	29.683452	-95.574472
			8703 BOONE RD	HOUSTON	29.683452	-95.574472
			8703 BOONE RD	HOUSTON	29.683452	-95.574472
		SMART STOP 4	10030 BISSONNET	HOUSTON	29.675	-95.554972
			10030 BISSONNET	HOUSTON	29.675	-95.554972
			10030 BISSONNET	HOUSTON	29.675	-95.554972
		STOP IN FOOD STORE	12751 S DAIR ASHFORD	HOUSTON	29.66151	-95.597674
			12751 S DAIR ASHFORD	HOUSTON	29.66151	-95.597674
			12291 S DAIR ASHFORD ST	HOUSTON	29.669159	-95.603046
			12291 S DAIR ASHFORD ST	HOUSTON	29.669159	-95.603046
		STOP N GO 2323	12291 S DAIR ASHFORD ST	HOUSTON	29.669159	-95.603046
			11200 WILCREST	HOUSTON	29.659784	-95.56724
			11200 WILCREST	HOUSTON	29.659784	-95.56724
			11200 WILCREST	HOUSTON	29.659784	-95.56724
			11200 WILCREST	HOUSTON	29.659784	-95.56724
		SUGARLAND SERVICE CENTER	13300 W BELLFORT AVE	HOUSTON	29.661689	-95.617009
			13300 W BELLFORT AVE	HOUSTON	29.661689	-95.617009

FACZIP	DATABASE	SITENAME	ADD	CITY	LATITUDE	LONGITUDE
77099	TXUST	SUGARLAND SERVICE CENTER SUNMART 443	13300 W BELLFORT AVE	HOUSTON	29.661689	-95.617009
			10841 BISSONNET	HOUSTON	29.673994	-95.568897
			10841 BISSONNET	HOUSTON	29.673994	-95.568897
			10841 BISSONNET	HOUSTON	29.673994	-95.568897
			10841 BISSONNET	HOUSTON	29.673994	-95.568897
		SUNN S FOOD & GAS	10612 S KIRKWOOD RD	HOUSTON	29.6628	-95.5851
			10612 S KIRKWOOD RD	HOUSTON	29.6628	-95.5851
		SW PARKWA MALL CITGO	8800 W SAM HOUSTON PKW S	HOUSTON	29.6871	-95.5581
			8800 W SAM HOUSTON PKW S	HOUSTON	29.6871	-95.5581
			8800 W SAM HOUSTON PKW S	HOUSTON	29.6871	-95.5581
			8800 W SAM HOUSTON PKW S	HOUSTON	29.6871	-95.5581
			8800 W SAM HOUSTON PKW S	HOUSTON	29.6871	-95.5581
			8800 W SAM HOUSTON PKW S	HOUSTON	29.6871	-95.5581
		TEXACO	8800 W SAM HOUSTON PKW S	HOUSTON	29.6871	-95.5581
			7148 BISSONNET	HOUSTON	29.687235	-95.508281
			7148 BISSONNET	HOUSTON	29.687235	-95.508281
			7148 BISSONNET	HOUSTON	29.687235	-95.508281
			7148 BISSONNET	HOUSTON	29.687235	-95.508281
			7148 BISSONNET	HOUSTON	29.687235	-95.508281
			7148 BISSONNET	HOUSTON	29.687235	-95.508281
			7148 BISSONNET	HOUSTON	29.687235	-95.508281
			7148 BISSONNET	HOUSTON	29.687235	-95.508281
			7148 BISSONNET	HOUSTON	29.687235	-95.508281
		TEXACO SERVICE STATION	11905 BISSONNET	HOUSTON	29.675179	-95.58737
			11905 BISSONNET	HOUSTON	29.675179	-95.58737
			11905 BISSONNET	HOUSTON	29.675179	-95.58737
			11905 BISSONNET	HOUSTON	29.675179	-95.58737
		TUNE UP PLUS	10713 W BELLFORT ST	HOUSTON	29.653707	-95.567652
			7303 BELLAIRE	HOUSTON	29.704495	-95.514225
		V-N FOOD STORE 490	9722 LEAWOOD	HOUSTON	29.673544	-95.577333
			9722 LEAWOOD	HOUSTON	29.673544	-95.577333
		WILCREST FACILIT	11111 S WILCREST	HOUSTON	29.66029	-95.567007
77099-125	TXLF	LIVINGSTON CONST CO	12701 Bissonnet St 77031	Houston	29.677799	-95.602008
	TXSPILL	CHEVRON	12703 Bissonnet St 3	Houston	29.677819	-95.602074
77099-170	TXUST	CHEVRON 60151612	10902 Bissonnet St	Houston	29.674185	-95.570242
			10902 Bissonnet St	Houston	29.674185	-95.570242
			10902 BISSONNET ST	HOUSTON	29.674185	-95.570242
			10902 BISSONNET ST	HOUSTON	29.674185	-95.570242
			10902 BISSONNET ST	HOUSTON	29.674185	-95.570242
77099-1850	RCRA-G TXUST	WAL MART SUPERCENTER NO 33 FOOD STORE	9460 W SAM HOUSTON PARKWA S	HOUSTON	29.679	-95.5597
			11575 BISSONNET ST	HOUSTON	29.674909	-95.582978
			11575 BISSONNET ST	HOUSTON	29.674909	-95.582978
			11575 BISSONNET ST	HOUSTON	29.674909	-95.582978
77099-223		BEST FOOD 5	13102 BISSONNET ST	HOUSTON	29.680742	-95.612666
			13102 BISSONNET ST	HOUSTON	29.680742	-95.612666
			13102 BISSONNET ST	HOUSTON	29.680742	-95.612666
77099-282	77099-332	TKMS ALL SEASON FOOD STORE RICE WELDING SUPPL CO INC	10606 S WILCREST DR	HOUSTON	29.664899	-95.568211
			10141 MARGATE DR	HOUSTON	29.667949	-95.580506
77099-345	ERNS TXSPILL RCRA-G TXSPILL 77099-470	TOP KING SHERWIN WILLIAMS AUTOMOTIV HOUSTON LIGHT & POWER HOUSTON LIGH & POWER	10141 MARGATE DR	HOUSTON	29.667949	-95.580506
			10250 Lands End Dr	Houston	29.666414	-95.574432
			10405 Rockley Rd	Houston	29.661892	-95.560538
			11100 WILCREST DRIVE	HOUSTON	29.660377	-95.567084
			10903 Ensbrook Dr	Houston	29.652138	-95.571148
			11015 Ensbrook Dr	Houston	29.653285	-95.573278



# Order Form

Phase I Support Services

ERCI

tel. 800-583-0004

From: **Greg Carter**  
**ERC**  
**10801 Hammerly Blvd. Suite 222**  
**Houston, TX 77043**  
**Fax: 713.290.9441**  
**Tel: 713.290.9444**

**order online**  
**www.telall.com**

## Site Information

☐ Map Included of Approximate Site Area for Increased Accuracy.

Project Name:	Project #
Street Address:	
City, County, State, Zip:	
Cross Street / Special Instructions	

For Same Day Service Please Order Before Noon C.S.T.

Some Services Available Regionally

- |   |  |  |
|---|--|--|
| <input type="checkbox"/> <b>TelALL ASTM Radius Data Search / Historical Aerial Photo Combo Package</b>                  | * Call for Approximate Aerial Coverage   | <b>\$144</b>   |
| *Save with TelALL's Most Popular Package  |  |  |
| <input type="checkbox"/> <b>TelALL ASTM Radius Data Search</b>  | *Recent NAPP Aerial Photo Included   |  |
| *ASTM Search Distances with Color Map included  | *Current USGS Map Included   | *Hardcopy or Internet Delivery <b>\$98</b>               |
| <input type="checkbox"/> <b>Extra Quarter Option</b>  | *Add an Extra Quarter Mile to our ASTM Radius Search or Combo                  | *Great for Larger Properties                             |
| Use with the ASTM Radius Search or Combo to add a 1/4 mile to all Databases. (adds +1.76 sq. mi. of total search area!) |  | <b>\$56</b>  |
| <input type="checkbox"/> <b>TelALL Custom Boundary Data Search</b>  | *Recent NAPP Aerial Photo Included   | *Current USGS Map Included                               |
| *ASTM Distances From Actual Property Boundaries   | *Great for Large or Irregular Sites  | <b>Call /Quote</b>                                       |
| <input type="checkbox"/> <b>TelALL Historical Aerial Photography Search</b>   | *Call or Check Online for Approximate Aerial Coverage                          |  |
| *Laser Copies of up to 6 Decades  | *Same Day Service  | <b>\$64</b>  |
| <input type="checkbox"/> <b>E-AERIAL Photo Option</b>   | *Requires Historical Aerial Photography Search                                 | *Up to Six Photos. \$3 Each Additional Photo             |
| *Scan and Email of Aerial Photos  | *Same Day Delivery   | *Price Includes Mailing of Originals. (USPS) <b>\$20</b> |
| <input type="checkbox"/> <b>TelALL NEPA Check</b>   | *Flood Map, Wetlands Map, Parks, Preserves, Historic Sites, Endangered Species | *48 Hour Service <b>\$98</b>                             |

## Other TelALL Services:

\*Some Services Available Regionally

- |   |  |
|---|--|
| <input type="checkbox"/> City Directories (per hour) <b>\$60</b>            | <input type="checkbox"/> Water Well Search 1/2 Mile <b>\$165</b> |
| <input type="checkbox"/> NWI Wetland Map <b>\$40</b>                        | <input type="checkbox"/> Historical Topographic Map <b>\$35</b>  |
| <input type="checkbox"/> Aquifer Structure Map <b>\$40</b>                  | <input type="checkbox"/> FEMA Flood Insurance Map <b>\$25</b>    |
| <input type="checkbox"/> USGS Topo Map (7.5 min) <b>\$15</b>                | <input type="checkbox"/> Geologic Atlas Map <b>\$25</b>          |
| <input type="checkbox"/> Oil Gas Review (\$40 p/hour \$65 for location map) | <input type="checkbox"/> RecentPhoto (1995 doqq) <b>\$20</b>     |
| <input type="checkbox"/> <b>RUSH Status!</b> <b>+20% of Total Order</b>     | <input type="checkbox"/> Soil Survey Map <b>\$25</b>             |

## Shipping Options

\*Next Day Shipping \$20 if no Account # is Provided

- ☐ **Internet Delivery of Radius Search** \*Free  
E-Mail Address: \_\_\_\_\_
- ☐ **Fedex** ☐ Overnight AM Delivery ☐ Overnight PM Delivery ☐ 2nd Day  
Account # \_\_\_\_\_
- ☐ **U.P.S.** ☐ Overnight AM Delivery ☐ Overnight PM Delivery ☐ 2nd Day  
Account #: \_\_\_\_\_
- ☐ **Lone Star Overnight**  
Account #: \_\_\_\_\_

## Payment

\*\*Payment due on receipt of invoice. Customer is responsible for collection fees, court costs and reasonable attorney fees to collect unpaid invoices.

PO #: \_\_\_\_\_

☐ **VISA - MC - AMEX** (Circle one)

Card # \_\_\_\_\_

Expiration \_\_\_\_\_ / \_\_\_\_\_

Name on Card \_\_\_\_\_

**Questions? Call 1-800-583-0004**